



U.S. Department
of Transportation

**National Highway
Traffic Safety
Administration**

400 Seventh Street, S.W.
Washington, D.C. 20590

Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

*** *** ***



AUTO SAFETY HOTLINE
(800) 424-9393
Wash. D.C. Area 366-0123

194-00

Case Vehicle (A): 1998 Toyota
Type: Camry LE, 4-door sedan
Driver: 37-year-old female
CDC: 11-FDEW-1, 03-RYEW-2

Vehicle (B): 1988 Lincoln
Type: Town Car, 4-door sedan
Driver: 23-year-old female
CDC: 99-0000-0

Vehicle (C): 1989 Ford
Type: Thunderbird LX, 2-door sedan
Driver: 33-year-old female
CDC: 99-0000-0

SITUATION

(Slides 1, 2) On a clear, dry day, case vehicle (A) was traveling north at a driver-estimated speed of 35 mph (56 kph) in the center lane of a three-lane, one-way asphalt road, and was approaching an intersection. Vehicle (B) was traveling east at an unknown speed in the through lane of the intersecting three-lane road. As case vehicle (A) began to enter the intersection, the driver of vehicle (B) proceeded into the intersection. The driver of case vehicle (A) braked and steered to the right, but was unable to avoid striking vehicle (B) in the right side with its front. After the impact, case vehicle (A) rotated clockwise and crossed the lane line into the right northbound lane. Vehicle (C), that was traveling in the right northbound lane, was unable to avoid striking the right side of case vehicle (A) with its front.

GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

(Slides 3, 4) The direct damage to case vehicle (A) from the frontal impact began at the left-front bumper corner and extended 162-cm across the entire front bumper. The maximum crush was 24 cm to the center portion of the front bumper. The direct damage from the right-side impact began at the right-front wheel and extended 106-cm rearward along the fender and right-front door panel. The maximum crush was 7 cm to the right-front door.

Using the WinSMASH accident-reconstruction program and c-values measured for (slides 5, 6, 7, 8, 9 and 10) case vehicle (A), the following impact severity was calculated for the frontal impact:

Vehicle	Variable	Calculated Velocity Change - kph (mph)		
		Total	Longitudinal	Latitudinal
Case Vehicle (A)	EBS	24 (15)	-23 (-14)	6 (4)

DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)

Exterior

(Slides 11, 12) The front bumper was crushed and the cover was separated from the vehicle.

(Slides 13, 14) The grille was damaged, both headlights were partially detached, and the left-turn indicator light was broken. (Slide 15) The hood was crushed, the damaged hood latch was jammed, and both hood hinges were deformed, but not separated. (Slide 16) The rear edge of the hood was elevated, but it did not contact the windshield. There was a small crack in the lower-center portion of the windshield due to deformation of the windshield cowl. (Slides 17, 18 and 19) On the left side, the fender was damaged and the left-rear tire was flat. (Slide 20) There was no other damage to the left side, both doors were operational, and there was no change in the left wheelbase.

(Slide 21) On the right side, the fender and front door were damaged from the second impact.

(Slides 22, 23) The damage extended across the lower portion of the fender just behind the wheel and into the front door panel. (Slide 24) There was no other damage to the right side, both doors were operational, and there was no change in the right wheelbase.

(Slide 25) There was no damage to the rear of case vehicle (A).

Interior

(Slides 26, 27) This vehicle is equipped with steering-wheel and passenger frontal-impact airbags, which deployed during the frontal impact. (Slides 28) There were black marks, possibly cosmetics, on the steering-wheel airbag, indicating driver facial contact. (Slides 29, 30) There was no damage to the steering-wheel rim and no rotation of the steering column. (Slides 31, 32 and 33) There was no damage to, and no contact marks on, the windshield, header, or roof area. (Slide 34) There was no damage to the upper or mid portions of the instrument panel. (Slide 35) There was a scuff mark on the knee bolster that indicates contact by the driver, but there was no damage to the panel. (Slides 36, 37) There was no damage to the center dash area, center

console, or glove compartment. There was no other interior damage and no intrusions were noted.

OCCUPANT KINEMATICS AND INJURIES

(Slide 38) The 5-ft, 5-in, 150-lb, 37-year-old female driver was wearing the three-point belt and the airbag deployed. The front seatbelts of this vehicle are equipped with pretensioners that were triggered by the impact. (Slides 39, 40) The driver's seatbelt was locked in an extended position, indicating belt use at the time of the crash and firing of the pretensioner. Also, there were marks on the shoulder-belt webbing from the D-ring indicating belt use. The driver reportedly had the seat adjusted to a mid-to-forward seat-track position, the steering-wheel tilt adjuster in the lowest position. She reportedly had both hands on the steering wheel, and braked and steered to the right just prior to the crash.

During the frontal impact, she continued forward and slightly to the left relative to the vehicle interior, into the airbag and seatbelt. She sustained cervical neck strain, probably due to impact forces. (Slides 41, 42) She sustained an abrasion to her right cheek from contact by the deploying airbag. She sustained abrasions to the anterior portions of both forearms, from contact by the deploying airbag. She sustained contusions across her left knuckles, possibly from the airbag flinging her hand into the instrument panel or other interior object. In addition, she sustained contusions across her left shoulder and left breast from loading by the shoulder-belt webbing. (Slides 43, 44) She sustained abrasions and a 20-cm contusion to the medial aspect of her left leg just above the knee, from contact with the knee bolster, as indicated by scuff marks on the bolster cover. She also sustained a contusion to her left lateral thigh, possibly from contact with the side-door panel.

(Slide 45) The 5-ft 6-in, 190-lb, 51-year-old, right-front female passenger was wearing the available three-point belt and the airbag deployed. (Slides 46, 47) Marks on the shoulder-belt webbing from the D-ring indicate belt use at the time of the crash. The passenger's seatbelt was locked in an extended position, indicating firing of the pretensioner. The passenger reportedly had the seat adjusted to a rear seat-track position and the seatback slightly reclined. She was wearing eyeglasses, which came off during the crash but were undamaged.

During the frontal impact, the passenger continued forward and slightly to the left relative to the vehicle interior, into the airbag and seatbelt. She sustained contusions across her right shoulder, from loading by the shoulder belt webbing. In addition, she sustained a 3-cm contusion to her left hip, from contact with the buckle assembly. She also complained of neck pain, but medical records indicate she did not sustain cervical neck strain.

The following tables and attached drawings (slides 48, 49) summarize the injuries for the two restrained occupants.

Occupant: Driver
 Restraints: 3-point belt worn; airbag deployed

Age: 37 years
 Stature: 165 cm (5 ft, 5 in)

Gender: Female
 Mass: 68 kg (150 lb)

Injury Description	A.I.S.	Injury Source		
		Definite	Probable	Possible
Cervical strain	1		Impact force	
Abrasion, right cheek	1	Airbag		
Contusions, across left shoulder	1	Shoulder belt webbing		
Contusions, across left breast	1	Shoulder belt webbing		
Abrasions, left anterior forearm	1	Airbag		
Abrasions, right anterior forearm	1	Airbag		
Contusions, across left knuckles	1			Instrument panel, airbag fling into unknown interior object
20-cm contusion, left medial leg just above the knee	1		Knee bolster	
Abrasions, left medial leg just above the knee	1		Knee bolster	
Contusion, left lateral thigh	1			Side door panel
<u>Maximum A.I.S. Level</u>	<u>1</u>			
<u>Injury Severity Score</u>	<u>2</u>			

Occupant: Right front
Restraints: 3-point belt worn; airbag deployed

Age: 51 years
Stature: 168 cm (5 ft, 6 in)

Gender: Female
Mass: 86 kg (190 lb)

Injury Description	A.I.S.	Injury Source		
		Definite	Probable	Possible
Contusions, across right shoulder	1	Shoulder belt webbing		
3-cm contusion, left hip	1		Buckle assembly	
<u>Maximum A.I.S. Level</u>	<u>1</u>			
<u>Injury Severity Score</u>	<u>1</u>			

Duplicate columns 1-8
from the previous card.

Module G 1 Format 0 2
9 10 11 12

GENERAL INFORMATION GI-1

TIME

DATE OF COLLISION

 / /

HOUR OF COLLISION

(24 HOUR CLOCK)

ENVIRONMENTAL CONDITIONS

CONSTRUCTION ZONE

- (0) NO
- (1) YES
- (9) UNKNOWN

0
33

ROAD ALIGNMENT
VERTICAL PLANE

- (1) LEVEL
- (2) CREST OF HILL
- (3) SLOPE (2%)
- (4) BOTTOM OF HILL
- (9) UNKNOWN

1
34

ROAD ALIGNMENT
HORIZONTAL PLANE

- (1) STRAIGHT
- (2) CURVE
- (3) T - SHAPED
- (4) Y - SHAPED
- (7) OTHER:
- (9) UNKNOWN

1
35

SURFACE COVERING

- (10) DRY
- (21) WATER - DAMP
- (22) WATER - WET
- (23) WATER - PUDDLED
- (29) WATER - AMOUNT UNKNOWN
- (31) SNOW - LOOSE
- (32) SNOW - PACKED
- (39) SNOW - CONDITION UNKNOWN
- (41) ICE
- (51) SLUSH
- (61) SPILLED GRAVEL
- (71) OTHER:
- (99) UNKNOWN

10
36 37

VISIBILITY LIMITATION
(FOR CASE VEHICLE)

- (0) NONE
- (1) CLOUDY/DARK
- (2) FOG
- (3) SMOKE
- (4) WINDSHIELD CONDITION
- (5) GLARE
- (6) RAIN
- (7) OTHER:
- (8) ICE/SNOW
- (9) UNKNOWN

0
38

VISIBILITY OBSTRUCTION
(FOR CASE VEHICLE)

- (0) NONE
- (1) BUILDING
- (2) SIGN
- (3) VEGETATION (E.G. BUSHES, SHRUBS)
- (4) TREE
- (5) HILL OR CURVE IN ROAD
- (6) VEHICLE IN TRANSPORT
- (7) OTHER:
- (8) PARKED VEHICLE
- (9) UNKNOWN

0
39

LOCATION

STATE:

STATE FIPS CODE

AREA

- (1) URBAN
- (2) RURAL
- (9) UNKNOWN

1
27

ENVIRONMENTAL CONDITIONS

LIMITED-ACCESS HIGHWAY

- (0) NO
- (1) YES
- (9) UNKNOWN

0
28

ROAD, TOTAL TRAFFIC LANES
(FOR CASE VEHICLE)

- (1) 1-LANE
- (2) 2-LANES
- (3) 3-LANES
- (4) 4 OR MORE LANES
- (5) DIVIDED, 4 OR MORE LANES
- (6) PARKING LOT/DRIVEWAY
- (7) OTHER:
- (9) UNKNOWN

3
29

INTERSECTING RD, TOTAL LANES

CHOOSE FROM ABOVE LIST, OR

- (8) NOT APPLICABLE

3
30

TYPE OF ROAD SURFACE

- (1) ASPHALT
- (2) CONCRETE
- (3) GRAVEL
- (4) MORE THAN ONE (CIRCLE EACH)
- (7) OTHER:
- (9) UNKNOWN

1
31

ROAD DEFECTS

- (0) NO
- (1) YES
- (9) UNKNOWN

0
32

GENERAL INFORMATION GI-2

ENVIRONMENTAL CONDITIONS

SPEED LIMIT

(0)	5-45 km/h	5-25 mph
(1)	46-55	30
(2)	56-60	35
(3)	61-70	40
(4)	71-79	45
(5)	80-85	50
(6)	86-90	55
(7)	91-105	60
(8)	OVER 105	65
(9)	UNKNOWN	

25 ml
40Kph

0

PRECIPITATION

(0) NONE
(1) RAIN
(2) SNOW
(3) HAIL
(4) FREEZING RAIN/SLEET
(7) OTHER: _____
(9) UNKNOWN

0
41

RATE OF PRECIPITATION

(1) LIGHT/MIST
(2) MODERATE
(3) HEAVY
(8) NOT APPLICABLE
(9) UNKNOWN

8
42

TEMPERATURE

(0) BELOW -15° C BELOW 5° F
(1) -15 TO -6 5 TO 22
(2) -5 TO -1 23 TO 31
(3) 0 TO 2 32 TO 36
(4) 3 TO 5 37 TO 41
(5) 6 TO 15 42 TO 59
(6) 16 TO 25 60 TO 77
(7) 26 TO 35 78 TO 95
(8) OVER 35 OVER 96
(9) UNKNOWN

9

CROSSWIND

(0) NONE
(1) LIGHT
(2) STRONG
(3) GUSTY & STRONG
(9) UNKNOWN

9

LIGHT CONDITIONS

- (1) DAYLIGHT
- (2) DAWN
- (3) DUSK
- (4) DARK, LIGHTED
- (5) DARK, UNLIGHTED
- (6) DARK, UNKNOWN IF LIGHTED
- (9) UNKNOWN

45

MECHANICAL MALFUNCTION

WAS THERE MENTION
OF A MECHANICAL MALFUNCTION
IN CASE VEHICLE

(0) NO
(1) YES
(2) YES, DID NOT CONTRIBUTE
TO ACCIDENT
(9) UNKNOWN

C
48

**THE FOLLOWING SECTION SHOULD BE FILLED
OUT IF A MECHANICAL MALFUNCTION IS
RECOGNIZED OR SUSPECTED.**

**CIRCLE ITEMS INVOLVED. SUPPORT ANY
ITEMS CIRCLED WITH COMMENTS.**

BRAKE SYSTEM

DRIVER CONTROLS

EXHAUST SYSTEM

POWER TRAIN

STEERING SYSTEM

FUEL SYSTEM

SUSPENSION SYSTEM

VISIBILITY ITEMS

ELECTRICAL SYSTEM

TIRES

THROTTLE CONTROLS

UNKNOWN

OTHER:

COMMENTS:

GENERAL INFORMATION GI-3

CRASH DETAILS

CASE VEHICLE AND OBJECT

- (0) NO
(1) YES
(9) UNKNOWN

0
47

CASE VEHICLE ROLLOVER

- (0) NO ROLLOVER
(1) YES, FIRST EVENT
(2) YES, SUBSEQUENT EVENT
(3) YES, SEQUENCE UNKNOWN
(9) UNKNOWN

0
48

CASE VEHICLE RAN OFF ROADWAY
(BEFORE FIRST IMPACT)

- (0) NO
(1) YES
(9) UNKNOWN

0
49

MOVING CASE VEHICLE AND
CONTACTED MOVING VEHICLE

- (0) NO
(1) YES
(9) UNKNOWN

1
50

CASE VEHICLE AND
CONTACTED STOPPED VEHICLE

- (0) NO
(1) YES
(9) UNKNOWN

0
51

STOPPED CASE VEHICLE AND
CONTACTED VEHICLE

- (0) NO
(1) YES
(9) UNKNOWN

0
52

TOTAL NUMBER
OF VEHICLES CONTACTED
BY CASE VEHICLE IN CRASH

- (8) 8 OR MORE
(9) UNKNOWN

2
53

ANY FIRE IN THIS CRASH
(NOT JUST CASE VEHICLE)

- (0) NO
(1) YES
(9) UNKNOWN

0
54

HIGHEST POLICE INJURY
SEVERITY CODE IN CRASH
(NOT JUST CASE VEHICLE)

- (0) O - NO INJURY
(1) C - POSSIBLE INJURY
(2) B - NON-INCAPACITATING INJURY
(3) A - INCAPACITATING INJURY
(4) K - FATAL
(5) INJURED, SEVERITY UNKNOWN
(6) DIED PRIOR TO ACCIDENT
(7) NON-FATAL INJURY
SEVERITY UNKNOWN
(9) UNKNOWN

3
55

DRIVER IMPAIRMENT

DRIVER ALCOHOL INVOLVEMENT
(CASE VEHICLE)

- (0) NONE
(1) YES
(9) UNKNOWN/NOT REPORTED/
NO DRIVER

0
56

DRIVER ALCOHOL BAC
(CASE VEHICLE)

- (80) NO TEST
(90) CHEMICAL TESTS, NO RESULTS
(95) AUTOPSY, NO RESULTS
(99) UNKNOWN

80
57 58

WAS THERE MENTION OF DRIVER
IMPAIRMENT FOR CASE VEHICLE?

- (0) NO
(1) YES
(9) UNKNOWN

0
59

LIST IMPAIRMENTS MENTIONED:

POST - CRASH DETAIL

MANNER CASE VEHICLE
LEFT SCENE

- (1) DRIVEN
(2) TOWED DUE TO DAMAGE
(3) TOWED, NOT DUE TO DAMAGE
(4) TOWED, REASON UNKNOWN
(9) UNKNOWN


2
60

ACCIDENT SCHEMATIC

ACCIDENT DESCRIPTION: CASE VEHICLE (A) WAS TRAVELING CASE VEHICLE (A): 1998 TOYOTA CAMRY Q
NORTH AT A DRIVER-ESTIMATED SPEED OF 35MPH (56KPH) OTHER VEHICLE (B): 1988 LINCOLN TOWN CAR A
IN THE CENTER LANE. VEHICLE (B) WAS TRAVELING EAST THIRD VEHICLE (C): 1989 FORD THUNDERBIRD
AND WAS APPROACHING THE INTERSECTING ROAD. AS CASE VEHICLE (A) ENTERED THE
INTERSECTION, IT STRUCK THE RIGHT SIDE OF VEHICLE (B). AFTER THE IMPACT, CASE
VEHICLE (A) ROTATED CLOCKWISE AND WAS STRUCK IN THE RIGHT SIDE BY VEHICLE
(C), WHICH WAS NORTHBOUND IN THE RIGHT LANE.



NORTH

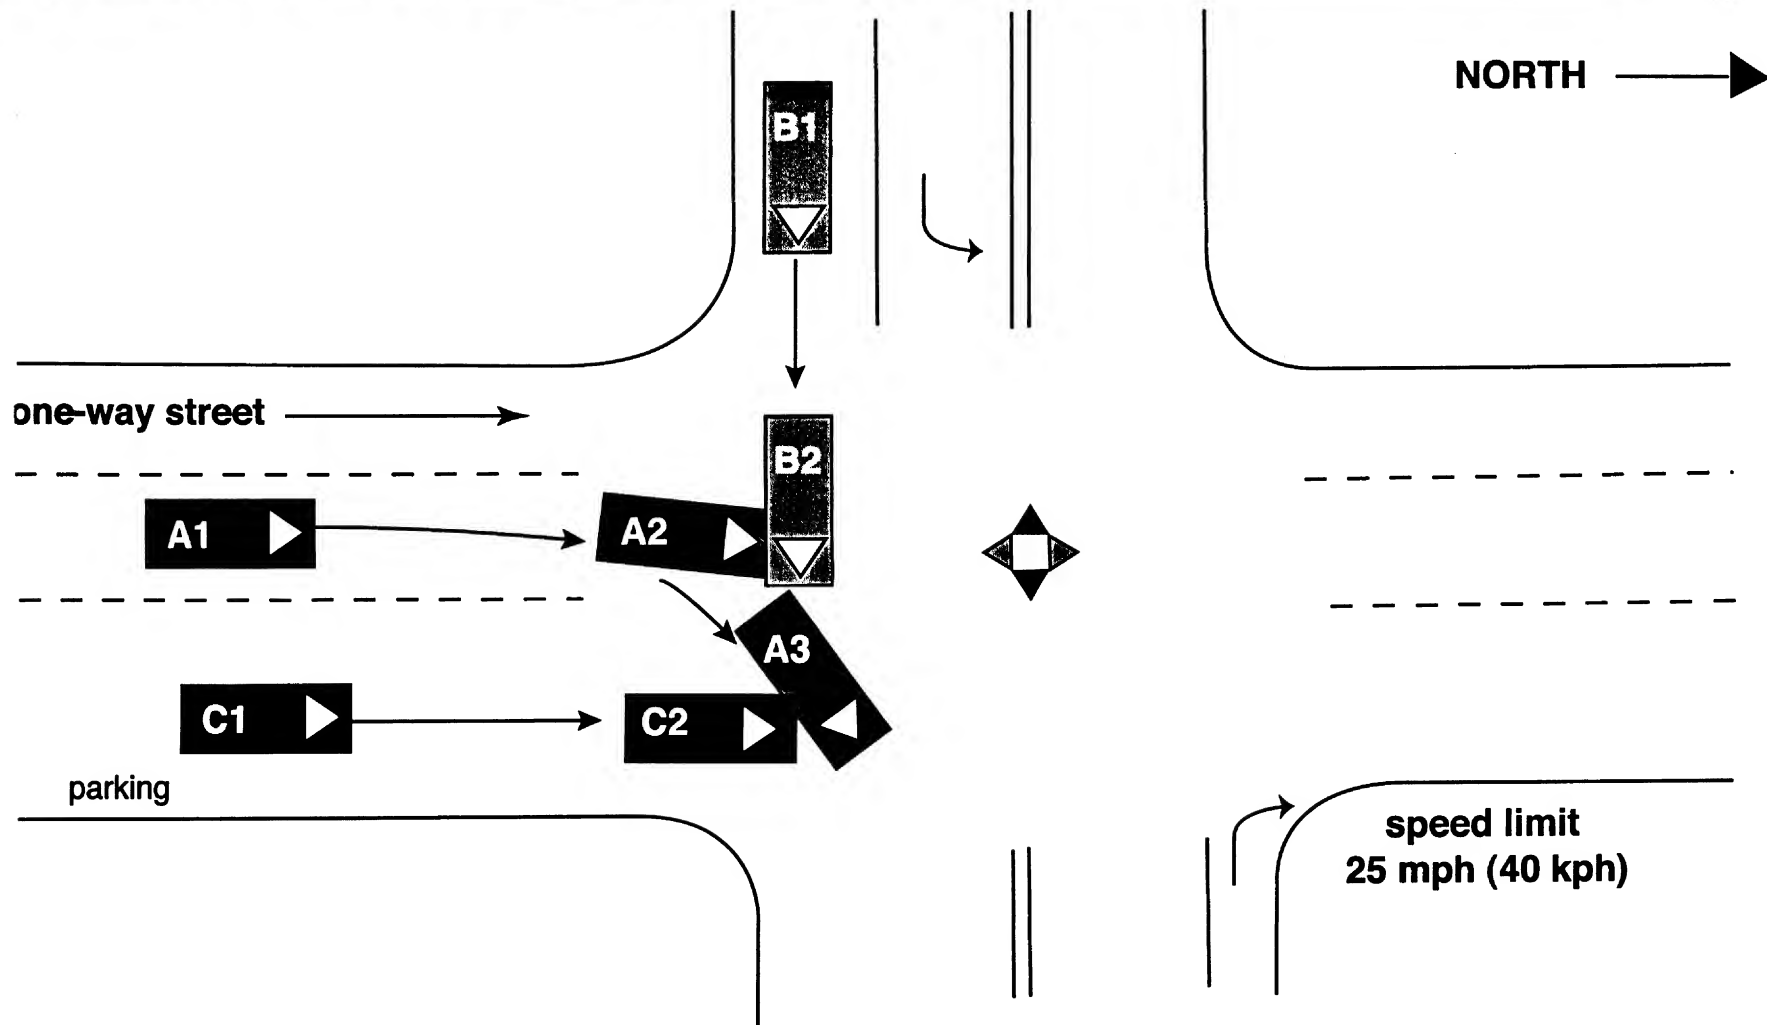

Duplicate columns 1-8
from the previous card.

Module 0 9 V 10 Format 0 4
11 12

OTHER VEHICLE OV-1

MAKE: LINCOLN

CARGO: UNKNOWN

MODEL: TOWN CAR SIGNATURE 4-DR. SEDAN

VIN

1 L N B M 8 2 F 8 J Y 0 0 0 0 0
13 29

MANUFAC/BODY CODE

1 2 2 0 2
30 34

MAKE/MODEL CODE

1 3 4 0
38

MODEL YEAR

1 9 8 8
39 42

VEHICLE MASS (kg)

0 0 1 8 3 8
43 48

IF SEPARATE REPORT WAS MADE,
GIVE VEHICLE NUMBER

0

NUMBER OF OCCUPANTS
(ENTER 9'S IF UNKNOWN)

0 1
51

TRAVELING SPEED (km/h)

9 9 9
54

- (000) PARKED OR STOPPED
(995) JUST STARTING UP
(996) BACKING UP
(997) SPEED NOT EXCESSIVE (BUT UNKNOWN)
(998) SPEED EXCESSIVE (BUT UNKNOWN)
(999) UNKNOWN

HIGHEST POLICE INJURY SEVERITY
CODE FOR THIS VEHICLE

- (0) O - NO INJURY
(1) C - POSSIBLE INJURY
(2) B - NON-INCAPACITATING INJURY
(3) A - INCAPACITATING INJURY
(4) K - FATAL
(5) INJURED, SEVERITY UNKNOWN
(6) DIED PRIOR TO ACCIDENT
(7) NON-FATAL INJURY
SEVERITY UNKNOWN
(8) UNOCCUPIED VEHICLE
(NOT APPLICABLE)
(9) UNKNOWN

0
55

VEHICLE TYPE

PASSENGER VEHICLE

- (02) LARGE
(03) LIMOUSINE
(17) PICKUP CAR
(20) UNKNOWN PASSENGER VEHICLE BODY
(24) SUB-MINI
(25) MINI
(26) SUB-COMPACT
(27) COMPACT
(28) INTERMEDIATE
(29) FULL

2 9
56 57

MULTIPURPOSE PASSENGER VEHICLE

- (14) SMALL UTILITY (WHEELBASE LESS THAN 107",
E.G. JEEP, BRONCO)
(15) LARGE UTILITY (WHEELBASE MORE THAN 107",
E.G. PANEL TRUCK, SUBURBAN)
(16) PICKUP TRUCK WITH CANOPY/SHELL COVER
(17) PICKUP CAR WITH CANOPY/SHELL COVER
(21) MOTOR HOME
(22) PICKUP TRUCK WITH SLIDE-IN CAMPER
(23) PICKUP CAR WITH SLIDE-IN CAMPER
(31) CHASSIS-MOUNTED CAMPER

TRUCK

- (11) VAN
(12) PICKUP TRUCK
(13) UNKNOWN LIGHT TRUCK
(15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
(16) PICKUP TRUCK WITH CANOPY/SHELL COVER
(22) PICKUP TRUCK WITH SLIDE-IN CAMPER
(30) UNKNOWN TRUCK TYPE
(31) CHASSIS-MOUNTED CAMPER
(33) DELIVERY VAN (WALK-IN)
(34) STRAIGHT TRUCK
(35) TRUCK-TRACTOR (BOBTAIL)
(36) CHASSIS-CAB
(37) UNKNOWN HEAVY TRUCK
(38) TRACTOR & SEMI-TRAILER (SEMI)
(39) TRUCK (OR SEMI) & FULL TRAILER(S)

BUS

- (40) UNKNOWN BUS TYPE
(41) SCHOOL BUS
(42) INTERCITY BUS (BETWEEN CITIES)
(43) TRANSIT BUS (INTRACITY)
(44) STREETCAR (ON TRACKS)
(68) TRAIN (CARS)
(69) LOCOMOTIVE (ENGINE, SWITCHER)

(99) UNKNOWN

WHEELBASE (cm)
(999) UNKNOWN

2 9 8
58 59 60

Duplicate columns 1-8
from the previous card.

Module 0 V Format 0 2
9 10 11 12

OTHER VEHICLE OV-2

ORIGINAL SPECIFICATIONS

Wheelbase 298 cm

Curb Weight 1838 kg

Average Track Width 999 cm

Overall Length 556 cm

Overall Width (OAW) 199 cm

Front Overhang 115 cm


Rear Overhang 143 cm

Undeformed End Width (UEW) 999 cm

Engine Displacement 5.0 L

Engine: # of Cylinders 08

MEASUREMENTS IN CENTIMETERS

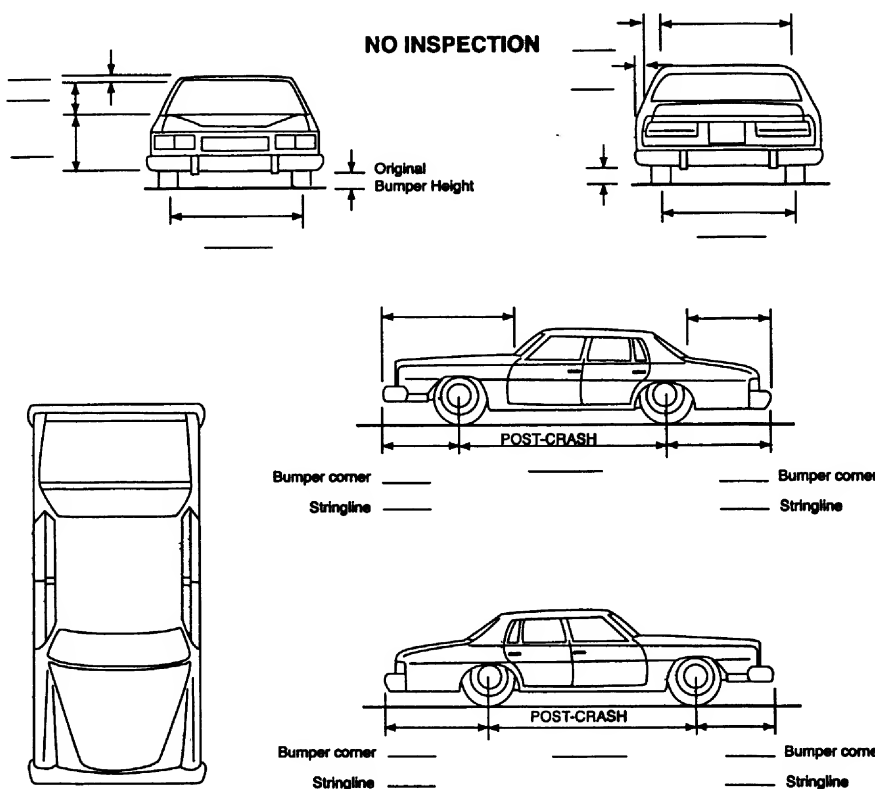

FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL) 999 cm

Front-End Overlap (Percent) = $\frac{DDL}{UEW}$ 99 %

Vehicle Overlap (Percent) = $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$ 99 %

Duplicate columns 1-8
from the previous card.Module 0 9 10 Format 0 4
9 10 11 12

OTHER VEHICLE OV-1

MAKE: FORDCARGO: UNKNOWNMODEL: THUNDERBIRD LX 2-DR. SEDANVIN 1 F A P P 6 2 4 7 K 4 0 0 0 0 0
13 29MANUFAC/BODY CODE 12129
30 31MAKE/MODEL CODE 0271
38MODEL YEAR 1989
39 42VEHICLE MASS (kg) 001606
43 46IF SEPARATE REPORT WAS MADE,
GIVE VEHICLE NUMBER 0NUMBER OF OCCUPANTS
(ENTER 9'S IF UNKNOWN) 02
51TRAVELING SPEED (km/h) 999
54

- (000) PARKED OR STOPPED
 (995) JUST STARTING UP
 (996) BACKING UP
 (997) SPEED NOT EXCESSIVE (BUT UNKNOWN)
 (998) SPEED EXCESSIVE (BUT UNKNOWN)
 (999) UNKNOWN

HIGHEST POLICE INJURY SEVERITY
CODE FOR THIS VEHICLE

- (0) O - NO INJURY
 (1) C - POSSIBLE INJURY
 (2) B - NON-INCAPACITATING INJURY
 (3) A - INCAPACITATING INJURY
 (4) K - FATAL
 (5) INJURED, SEVERITY UNKNOWN
 (6) DIED PRIOR TO ACCIDENT
 (7) NON-FATAL INJURY
 SEVERITY UNKNOWN
 (8) UNOCCUPIED VEHICLE
 (NOT APPLICABLE)
 (9) UNKNOWN

3
55

VEHICLE TYPE

PASSENGER VEHICLE

- (02) LARGE
 (03) LIMOUSINE
 (17) PICKUP CAR
 (20) UNKNOWN PASSENGER VEHICLE BODY
 (24) SUB-MINI
 (25) MINI
 (26) SUB-COMPACT
 (27) COMPACT
 (28) INTERMEDIATE
 (29) FULL

MULTIPURPOSE PASSENGER VEHICLE

- (14) SMALL UTILITY (WHEELBASE LESS THAN 107",
E.G. JEEP, BRONCO)
 (15) LARGE UTILITY (WHEELBASE MORE THAN 107",
E.G. PANEL TRUCK, SUBURBAN)
 (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
 (17) PICKUP CAR WITH CANOPY/SHELL COVER
 (21) MOTOR HOME
 (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
 (23) PICKUP CAR WITH SLIDE-IN CAMPER
 (31) CHASSIS-MOUNTED CAMPER

TRUCK

- (11) VAN
 (12) PICKUP TRUCK
 (13) UNKNOWN LIGHT TRUCK
 (15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
 (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
 (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
 (30) UNKNOWN TRUCK TYPE
 (31) CHASSIS-MOUNTED CAMPER
 (33) DELIVERY VAN (WALK-IN)
 (34) STRAIGHT TRUCK
 (35) TRUCK-TRACTOR (BOBTAIL)
 (36) CHASSIS-CAB
 (37) UNKNOWN HEAVY TRUCK
 (38) TRACTOR & SEMI-TRAILER (SEMI)
 (39) TRUCK (OR SEMI) & FULL TRAILER(S)

BUS

- (40) UNKNOWN BUS TYPE
 (41) SCHOOL BUS
 (42) INTERCITY BUS (BETWEEN CITIES)
 (43) TRANSIT BUS (INTRACITY)
 (44) STREETCAR (ON TRACKS)

- (68) TRAIN (CARS)
 (69) LOCOMOTIVE (ENGINE, SWITCHER)

(99) UNKNOWN

WHEELBASE (cm)

(999) UNKNOWN

287
56 58 60

Duplicate columns 1-8
from the previous card.

Module 0 V Format 0 2
9 10 11 12

OTHER VEHICLE OV-2

ORIGINAL SPECIFICATIONS

Wheelbase 287 cm

Curb Weight 1606 kg

Average Track Width 158 cm

Overall Length 505 cm

Overall Width (OAW) 185 cm

Front Overhang 109 cm


Rear Overhang 111 cm

Undeformed End Width (UEW) 999 cm

Engine Displacement 3.8 L

Engine: # of Cylinders 06

VEHICLE DAMAGE

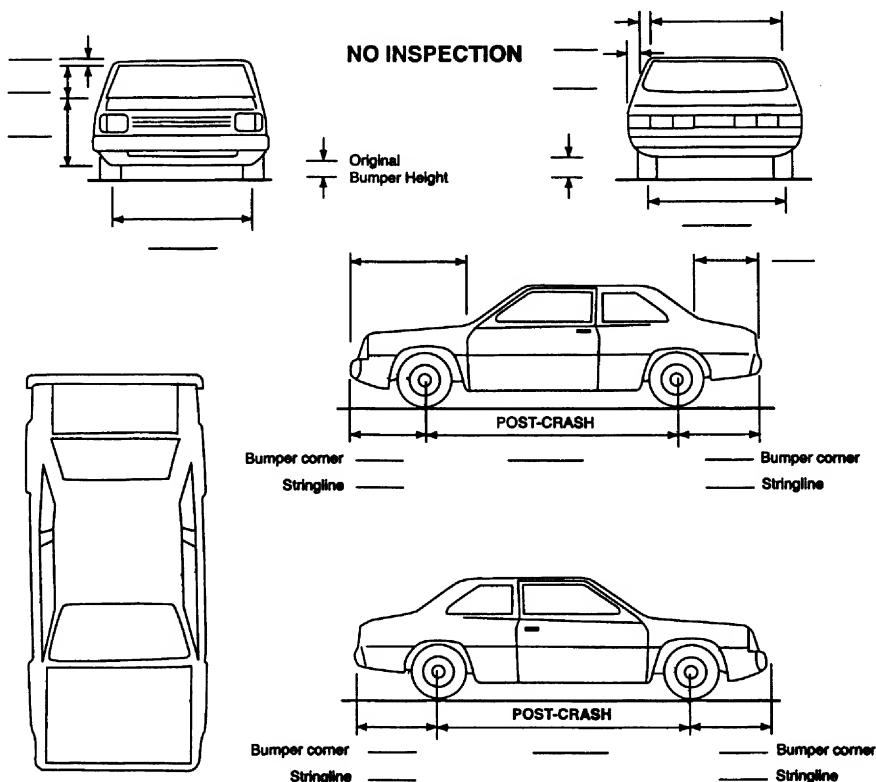

FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL) 999 cm

Front-End Overlap (Percent) = $\frac{DDL}{UEW}$ 99 %

Vehicle Overlap (Percent) = $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$ 99 %

Duplicate columns 1-8
from the previous card.Module V D Format 0 4
9 10 11 12

VEHICLE DESCRIPTION VD-1

MAKE: TOYOTA
MODEL: CAMRY LE 4-DOOR SEDANCARGO: NONEVIN 4 T 1 B G 2 2 K 7 W U 0 0 0 0 0
13 29MANUFAC/BODY CODE 1 8 3 2 7
30 34MAKE/MODEL CODE 1 6 1 0
38MODEL YEAR 1 9 9 8
39 42VEHICLE MASS (kg) 0 0 1 4 1 5
43 48ODOMETER (km) 8 8 8 8 8 8
(ENTER 9'S IF UNKNOWN) 49 54
(ENTER 8'S IF ELECTRONIC)NUMBER OF OCCUPANTS 0 2
(ENTER 9'S IF UNKNOWN) 56TRAVELING SPEED (km/h) 35 mph 0 5 6
59

- (000) PARKED OR STOPPED
(995) JUST STARTING UP
(996) BACKING UP
(997) SPEED NOT EXCESSIVE (BUT UNKNOWN)
(998) SPEED EXCESSIVE (BUT UNKNOWN)
(999) UNKNOWN

VEHICLE TYPE

PASSENGER VEHICLE

- (11) 2-DOOR HARDTOP (NO UPPER B-PILLAR)
(12) 2-DOOR SEDAN OR COUPE
(ANY UPPER B-PILLAR)
(13) 4-DOOR HARDTOP
(14) 4-DOOR SEDAN
(15) STATION WAGON
(16) CONVERTIBLE
(18) OTHER PASS. VEH. :
(19) PASSENGER VEHICLE, TYPE UNKNOWN

MULTIPURPOSE PASSENGER VEHICLE

- (21) SMALL UTILITY (E.G. JEEP, SCOUT, BRONCO)
(22) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
(23) VAN, SIZE UNKNOWN
(24) VAN, SMALL (MINI)
(25) VAN, LARGE
(29) MPV, TYPE UNKNOWN
(30) MOTOR HOME

TRUCK

- (31) PICKUP TRUCK, UNKNOWN
(32) PICKUP TRUCK, SMALL (DOWNSIZED)
(33) PICKUP TRUCK, LARGE

(99) UNKNOWN

STOLEN VEHICLE

- (0) NO
(1) YES
(8) NOT COLLECTED
(9) UNKNOWN

8
62

BODY STRUCTURE

- (1) BODY & FRAME
(2) UNITIZED
(3) INTEGRAL-STUB FRAME
(4) BODY & PLATFORM FRAME
(E.G. VW BUG)
(5) PARTIALLY UNITIZED
(7) OTHER:
(9) UNKNOWN

2
63

TRANSMISSION

- (0) NONE
(1) AUTOMATIC
(2) MANUAL
(9) UNKNOWN

1
64LOCATION OF TRANSMISSION
SELECTOR LEVER

- (1) FLOOR
(2) CONSOLE
(3) COLUMN
(7) OTHER:
(9) UNKNOWN

2
65

STEERING

- (1) POWER
(2) MANUAL
(9) UNKNOWN

1
66

BRAKES

- (1) POWER
(2) MANUAL
(9) UNKNOWN

1
67

VEHICLE DESCRIPTION

VD-2

TYPE OF BRAKES

- (0) DRUM, ALL WHEELS
 (2) DISC, FRONT WHEELS
 (3) DISC, ALL WHEELS
 (9) UNKNOWN

2
 68

WHEELBASE (cm)
 (999) Unknown

266
 76 77 78

BRAKE ANTI-LOCK DEVICE

- (0) NONE INSTALLED
 (1) TWO-WHEEL
 (2) FOUR-WHEEL
 (7) EQUIPPED, UNKNOWN WHEELS
 (9) UNKNOWN

2
 69

PLASTIC ANTI-LACERATIVE
 INNER LAYER GLASS EQUIPPED

- (0) NONE
 (1) WINDSHIELD
 (2) WINDSHIELD AND SIDE
 (7) OTHER
 (9) UNKNOWN

0
 79

AIR CONDITIONING IN VEHICLE

- (0) NO
 (1) YES
 (8) NOT COLLECTED
 (9) UNKNOWN

8
 70

TYPE OF DRIVE

- (1) REAR WHEEL
 (2) FRONT WHEEL
 (3) FOUR WHEEL
 (4) ALL WHEEL DRIVE
 (9) UNKNOWN



2
 71

FIELD INVESTIGATOR INSTRUCTIONS:


1. INDICATE CRUSHED AREAS BY OUT-LINING NEW PERIMETER OF VEHICLE AND SHADING THE DAMAGED AREAS ON THE LARGE SKETCH ON PAGE VD-3. USE AS MANY SKETCHES AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE.
2. ENTER THE DIMENSIONS ON THE SKETCH(ES) MEASURED TO THE POINT OF MAXIMUM PENETRATION BY THE OBJECT(S) CONTACTED. USE THE EXAMPLES BELOW AS A GUIDE.
3. ENTER THE THREE DIMENSIONS TO THE CENTER OF THE WHEELS (WHEELBASE, FRONT AND REAR OVERHANGS) ON BOTH SIDES OF THE CAR.
4. ADD OTHER DIMENSIONS AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE.

EXAMPLES:

FRONT OR REAR

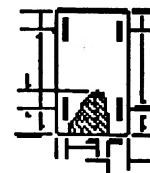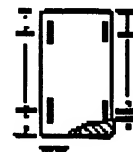

SIDE

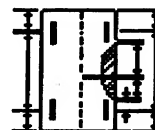

ROOF (REFERENCE TO
 TOP OF DOOR BILL
 OR WINDOW BILL)



DUAL REAR WHEELS

- (0) NO
 (1) YES
 (9) UNKNOWN

0
 72

ORIGINAL TYPE
 OF RESTRAINT SYSTEM

- (1) ACTIVE BELT
 (2) PASSIVE BELT
 (3) AIRBAG
 (4) KNEE BOLSTERS
 (7) OTHER: _____
 (8) NOT APPLICABLE (NOT EQUIPPED)
 (9) UNKNOWN

3
 73

EQUIPPED WITH ROLL BAR

- (0) NO
 (1) YES
 (9) UNKNOWN

0
 74

TYPE OF ROOF

- (0) NONE
 (1) SOLID
 (2) T-TOP CLOSED
 (3) T-TOP OPEN
 (4) SUN ROOF CLOSED
 (5) SUN ROOF OPEN
 (6) CONVERTIBLE CLOSED
 (7) CONVERTIBLE OPEN
 (8) OTHER: _____
 (9) UNKNOWN

1
 75

Duplicate columns 1-8
from the previous card.


Module V 9 10 Format 0 2
11 12

VEHICLE DESCRIPTION VD-3

ORIGINAL SPECIFICATIONS

Wheelbase	<u>266</u> cm	Front Overhang	<u>098</u> cm
Curb Weight	<u>1415</u> kg	Rear Overhang	<u>115</u> cm
Average Track Width	<u>153</u> cm	Undeformed End Width (UEW)	<u>162</u> cm
Overall Length	<u>479</u> cm	Engine Displacement	<u>1.8</u> L
Overall Width (OAW)	<u>178</u> cm	Engine: # of Cylinders	<u>04</u>

VEHICLE DAMAGE

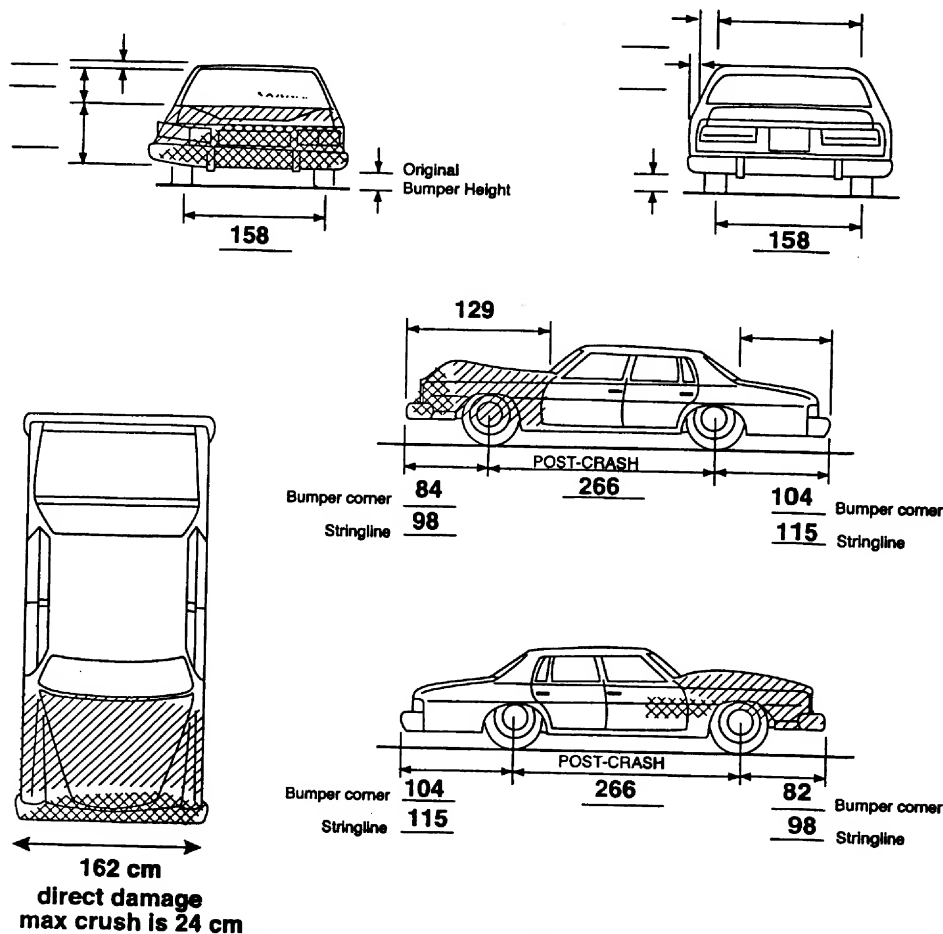

FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL) 162 cm

Front-End Overlap (Percent) = $\frac{DDL}{UEW}$

99 %

Vehicle Overlap (Percent) = $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$

999 %

Duplicate columns 1-8
from the previous card.Module D A Format 0 2
9 10 11 12

DAMAGE DA-1

PRIMARY	CASE VEHICLE PRIMARY CDC	CONTACTED VEHICLE ASSOCIATED CDC
EVENT NUMBER	<u>1</u> 13	VEHICLE B
IMPACT SPEED (km/h)	<u>999</u> 14 15 16	<u>999</u> 35 36 37
ESTIMATED BY	<u>1</u> 17	<u>1</u> 38
CRUSH (cm)	<u>024</u> 18 19 20	<u>999</u> 39 40 41
CDC #1	<u>11.FDEW.1</u> 21 27	<u>99.0000.0</u> 42 48
CDC #2	<u>98.0000.0</u> 28 34	<u>98.0000.0</u> 49 55

Duplicate columns 1-8
from the previous card.Module D A Format 0 3
9 10 11 12

SECONDARY	CASE VEHICLE SECONDARY CDC	CONTACTED VEHICLE ASSOCIATED CDC
EVENT NUMBER	<u>2</u> 13	VEHICLE C
IMPACT SPEED (km/h)	<u>999</u> 14 15 16	<u>999</u> 35 36 37
ESTIMATED BY	<u>1</u> 17	<u>1</u> 38
CRUSH (cm)	<u>007</u> 18 19 20	<u>999</u> 39 40 41
CDC #1	<u>013.RYEW.2</u> 21 27	<u>99.0000.0</u> 42 48
CDC #2	<u>98.0000.0</u> 28 34	<u>98.0000.0</u> 49 55

CODES

EVENT NUMBER

(8) NOT APPLICABLE
(9) UNKNOWN

IMPACT SPEED

(998) NOT APPLICABLE
(999) UNKNOWN

IMPACT SPEED ESTIMATOR

(1) INVESTIGATOR
(2) DRIVER
(3) POLICE
(4) "CRASH" PROGRAM
(5) OTHER COMPUTER PROGRAM
SPECIFY: _____
(7) OTHER: _____
(8) NOT APPLICABLE
(NO VEHICLE/NO IMPACT)

CRUSH

(998) NOT APPLICABLE
(NO VEHICLE/DAMAGE)
(999) UNKNOWN

CDC

(9800000) NOT APPLICABLE
(9900000) UNKNOWN

Duplicate columns 1-8
from the previous card.Module D A Format 0 1
9 10 11 12

DAMAGE DA-2

MAXIMUM SHEET METAL CRUSH

(cm) (999) UNKNOWN

FRONT 024
13 15RIGHT SIDE 007
16 18REAR 000
19 21LEFT SIDE 000
22 24ROOF 000
25 27OTHER 000
28 30CHRONOLOGICAL SEQUENCE
OF DAMAGE/INJURY PRODUCING CRASH EVENTS
FOR CASE VEHICLENOTE: IF CHRONOLOGICAL ORDER
IS UNKNOWN, EVENT
ORDER IS OPTIONAL.DO YOU KNOW THIS TABLE
TO BE IN CHRONOLOGICAL ORDER? 1

31

(0) NO
(1) YES

EVENT NUMBER	IMPACT LOCATION (1) ON ROADWAY (2) SHOULDER/MEDIAN/GORE (3) ON ROADSIDE (4) OUTSIDE ROADSIDE RIGHT-OF-WAY (5) OTHER (6) OFF ROADWAY, LOC. UNK. (9) UNKNOWN	IMPACT CONFIGURATION FOR CODES, SEE TABLE ON PAGE DA-3.	OBJECT/VEHICLE CONTACTED FOR CODES, SEE TABLE ON PAGE DA-4.
# 1	<u>1</u> 32	<u>13</u> 34	veh (B) <u>02</u> 36
#2	<u>1</u> 37	<u>41</u> 39	veh (C) <u>29</u> 41
#3	<u> </u> 42	<u> </u> 44	<u> </u> 46
#4	<u> </u> 47	<u> </u> 49	<u> </u> 51
#5	<u> </u> 52	<u> </u> 54	<u> </u> 56
#6	<u> </u> 57	<u> </u> 59	<u> </u> 61
#7	<u> </u> 62	<u> </u> 64	<u> </u> 66

CODES FOR
IMPACT CONFIGURATIONFRONT OF CASE VEHICLE

- (11) AND FRONT OF CONTACTED VEHICLE
- (13) AND SIDE OF CONTACTED VEHICLE
- (14) AND REAR OF CONTACTED VEHICLE
- (16) ENDSWIPED BY CONTACTED VEHICLE
- (17) AND OBJECT
- (19) AND UNKNOWN OTHER VEHICLE CONFIGURATION

LEFT SIDE OF CASE VEHICLE

- (21) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (22) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (23) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (24) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (25) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (26) SIDESWIPED BY CONTACTED VEHICLE
- (27) AND OBJECT
- (29) AND UNKNOWN OTHER VEHICLE CONFIGURATION

REAR OF CASE VEHICLE

- (31) AND FRONT OF CONTACTED VEHICLE
- (33) AND SIDE OF CONTACTED VEHICLE
- (34) AND REAR OF CONTACTED VEHICLE
- (36) ENDSWIPED BY CONTACTED VEHICLE
- (37) AND OBJECT
- (39) AND UNKNOWN OTHER VEHICLE CONFIGURATION

RIGHT SIDE OF CASE VEHICLE

- ✓ (41) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (42) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (43) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (44) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (45) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (46) SIDESWIPED BY CONTACTED VEHICLE
- (47) AND OBJECT
- (49) AND UNKNOWN OTHER VEHICLE CONFIGURATION

OTHER

- (57) VEHICLE TO OBJECT
- (58) VEHICLE TO VEHICLE
- (59) VEHICLE TO VEHICLE, CONFIGURATION UNKNOWN

ROLLOVER

- (61) LESS THAN 360°
- (62) 360° OR MORE
- (69) DETAILS UNKNOWN

UNKNOWN

- (99) IMPACT TYPE UNKNOWN

DAMAGE DA-4

CODES FOR VEHICLE/OBJECT CONTACTED

VEHICLE/OBJECT GROUPS

- (00) NO OBJECT
- (01) - (39) PASSENGER VEHICLE & TRUCK
- (40) - (69) OTHER VEHICLE
- (70) - (76) PEDESTRIAN & ON-ROADWAY OBJECT
- (77) - (97) OFF-ROADWAY OBJECT

- (98) OTHER (DESCRIBE)
- (99) UNKNOWN

PASSENGER VEHICLE

- (02) LARGE
- (03) LIMOUSINE
- (17) PICKUP
- (20) UNKNOWN PASSENGER VEHICLE BODY
- (24) SUB-MINI
- (25) MINI
- (26) SUB-COMPACT
- (27) COMPACT
- (28) INTERMEDIATE
- (29) FULL

SIZE

WHEELBASE

SUB-MINI	< 2286 mm (< 90")
MINI	2286 - 2412 mm (90" - 94.9")
SUB-COMPACT	2413 - 2539 mm (95" - 99.9")
COMPACT	2540 - 2666 mm (100" - 104.9")
INTERMEDIATE	2667 - 2793 mm (105" - 109.9")
FULL	2794 - 2920 mm (110" - 114.9")
LARGE	2921 - 3174 mm (115" - 124.9")
LIMOUSINE	> 3175 mm (> 125")

MULTIPURPOSE PASSENGER VEHICLE

- (11) SMALL VAN (MINI)
- (12) PICKUP
- (14) SMALL UTILITY (WHEELBASE LESS THAN 107",
E.G. JEEP, BRONCO)
- (15) LARGE UTILITY (WHEELBASE MORE THAN 107",
E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (17) PICKUP CAR WITH CANOPY/SHELL COVER
- (21) MOTOR HOME
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (23) PICKUP CAR WITH SLIDE-IN CAMPER
- (31) CHASSIS-MOUNTED CAMPER

TRUCK

- (11) SMALL VAN (E.G. ECONOLINE)
- (12) PICKUP TRUCK
- (13) UNKNOWN LIGHT TRUCK
- (15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (30) UNKNOWN TRUCK TYPE
- (31) CHASSIS-MOUNTED CAMPER
- (33) DELIVERY VAN (WALK-IN)
- (34) STRAIGHT TRUCK
- (35) TRUCK-TRACTOR (BOBTAIL)
- (36) CHASSIS-CAB
- (37) UNKNOWN HEAVY TRUCK
- (38) TRACTOR & SEMI-TRAILER (SEMI)
- (39) TRUCK (OR SEMI) & FULL TRAILER(S)

BUS

- (40) UNKNOWN BUS TYPE
- (41) SCHOOL BUS
- (42) INTERCITY BUS (BETWEEN CITIES)
- (43) TRANSIT BUS (INTRACITY)
- (44) STREETCAR (ON TRACKS)

MOTORCYCLE

- (50) UNKNOWN MOTORCYCLE TYPE
- (51) 1 - 75 cc
- (52) 76 - 125 cc
- (53) 126 - 250 cc
- (54) 251 - 500 cc
- (55) 501 - 750 cc
- (56) 751 cc +
- (57) 3-WHEELS (OR WITH SIDECAR)

SPECIAL PURPOSE VEHICLE

- (60) UNKNOWN/OTHER SPECIAL VEHICLE (DESCRIBE)
- (61) SNOWMOBILE
- (62) ATV (ALL TERRAIN VEHICLE)
- (63) AMPHIBIOUS VEHICLE
- (64) FARM VEHICLE
- (65) CONSTRUCTION VEHICLE
- (66) TRAILER, PRIVATE (CAMPER)
- (67) TRAILER, COMMERCIAL (CARGO)
- (68) TRAIN (CARS)
- (69) LOCOMOTIVE (ENGINE, SWITCHER)

OBJECT

- (70) PEDESTRIAN
- (71) BICYCLIST, OTHER PEDALCYCLIST
- (72) PEDESTRIAN CONVEYANCE (E.G. PERSON RIDING
ANIMAL, CART)
- (73) LARGE ANIMAL
- (74) FALLEN OBJECT (E.G. OBJECT DISLODGED FROM
OTHER VEHICLE, FALLEN TREE, ROCKS)
- (75) ROCKS
- (76) CONSTRUCTION EQUIPMENT (EXCLUDING (65))
- (77) SIGN POST, UTILITY POLE, TREE
- (78) DITCH
- (79) EMBANKMENT, SNOWBANK, RR TRACKS RR X
- (80) GROUND (ROLLOVER ONLY)
- (81) CURB (DAMAGE PRODUCING IMPACTS ONLY)
- (82) CULVERT
- (83) FENCE
- (84) HYDRANT, SHORT POST, STUMP
- (85) SMALL POST/TREE, RURAL MAIL BOX, MILE
MARKER, DELINEATOR
- (86) BUILDING
- (87) PIER, PILLAR, BRIDGE SUPPORT
- (88) ABUTMENT, RETAINING WALL
- (89) BRIDGE RAIL
- (90) GUARD RAIL, LEADING SECTION
- (91) GUARD RAIL, MIDDLE OR UNKNOWN
- (92) GUARD RAIL, TRAILING SECTION
- (93) GUARD POST (TIMBER, METAL, CONCRETE)
- (94) CABLE, FENCE BARRIER
- (95) CONCRETE BARRIER (MEDIAN)
- (96) IMPACT ATTENUATOR
- (97) BREAKAWAY FEATURES

Duplicate columns 1-8
from the previous card.Module C R Format 0 1
9 10 11 12CRASH RECONSTRUCTION CR-1
for ΔV

	CASE VEHICLE PRIMARY IMPACT		CASE VEHICLE SECONDARY IMPACT	
	CASE VEHICLE	CONTACTED VEHICLE	CASE VEHICLE	CONTACTED VEHICLE
EVENT NUMBER	<u>1</u> 13		<u>2</u> 47	
ΔV (km/h) TOTAL	<u>9</u> — 14 15 16	<u>9</u> — 32 33 34	<u>9</u> — 48 49 50	<u>9</u> — 66 67 68
LONGITUDINAL*	<u>9</u> — 17 — 20	<u>9</u> — 35 — 38	<u>9</u> — 51 — 54	<u>9</u> — 69 — 72
LATERAL*	<u>9</u> — 21 — 24	<u>9</u> — 39 — 42	<u>9</u> — 55 — 58	<u>9</u> — 73 — 76
*NOTE: THESE ΔV COMPONENTS MUST INCLUDE SIGN.				
EXAMPLES: 10 km/h = ± 010 -7 km/h = -007				
ENERGY DISSIPATED BY CRUSH (kJ)	<u>9</u> — 25 — 28	<u>9</u> — 43 — 46	<u>9</u> — 59 — 62	<u>9</u> — 77 — 80
RECONSTRUCTION				
(01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL	<u>12</u> 29 30		<u>12</u> 63 64	
(21) RECONSTRUCTED, LOW CONFIDENCE LEVEL				
(22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL				
(23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL				
NOT RECONSTRUCTED BECAUSE				
(02) INSUFFICIENT DATA				
(03) EXCESSIVE UNDERRIDE/ OVERRIDE				
(04) ROLLOVER				
(05) VAULTING				
(06) OTHER TRAVEL IN MORE THAN ONE PLANE				
(07) NON-HORIZONTAL FORCE				
(08) SIDESWIPE-TYPE DAMAGE				
(09) YIELDING OBJECT				
(10) OTHER: _____				
(11) AT LEAST ONE VEHICLE BEYOND SCOPE				
(12) OTHER VEHICLE NOT INSPECTED				
MODE				
(1) CDC ONLY				
(2) CDC & DETAILED DAMAGE	<u>5</u> 31		<u>5</u> 65	
(3) TRAJECTORY & CDC				
(4) TRAJECTORY & CDC & DETAILED DAMAGE				
(5) NOT RECONSTRUCTED				
COMPUTER PROGRAM SPECIFY: _____				


Duplicate columns 1-8
from the previous card.Module C R Format 0 2
9 10 11 12CRASH RECONSTRUCTION CR-2
for EBS

	CASE VEHICLE PRIMARY IMPACT		CASE VEHICLE SECONDARY IMPACT	
	CASE VEHICLE	CONTACTED VEHICLE	CASE VEHICLE	CONTACTED VEHICLE
EVENT NUMBER	<u>1</u> 13		<u>2</u> 47	
EBS (km/h) TOTAL	<u>024</u> 14 15 16	<u>9-</u> 32 33 34	<u>9-</u> 48 49 50	<u>9-</u> 66 67 68
LONGITUDINAL*	<u>-023</u> 17 20	<u>9-</u> 35 38	<u>9-</u> 51 54	<u>9-</u> 69 72
LATERAL*	<u>+006</u> 21 24	<u>9-</u> 39 42	<u>9-</u> 55 58	<u>9-</u> 73 76
*NOTE: THESE EBS COMPONENTS MUST INCLUDE SIGN.				
EXAMPLES: 10 km/h = ±010 -7 km/h = -007				
ENERGY DISSIPATED BY CRUSH (kJ)	<u>0039</u> 25 28	<u>9-</u> 43 46	<u>9-</u> 59 62	<u>9-</u> 77 80
RECONSTRUCTION				
(01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL	<u>22</u> 29 30		<u>12</u> 63 64	
(21) RECONSTRUCTED, LOW CONFIDENCE LEVEL				
(22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL				
(23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL				
NOT RECONSTRUCTED BECAUSE				
(02) INSUFFICIENT DATA				
(03) EXCESSIVE UNDERRIDE/ OVERRIDE				
(04) ROLLOVER				
(05) VAULTING				
(06) OTHER TRAVEL IN MORE THAN ONE PLANE				
(07) NON-HORIZONTAL FORCE				
(08) SIDESWIPE-TYPE DAMAGE				
(09) YIELDING OBJECT				
(10) OTHER: _____				
(11) AT LEAST ONE VEHICLE BEYOND SCOPE				
(12) OTHER VEHICLE NOT INSPECTED				
MODE				
(1) CDC ONLY				
(2) CDC & DETAILED DAMAGE	<u>2</u> 31		<u>5</u> 65	
(3) TRAJECTORY & CDC				
(4) TRAJECTORY & CDC & DETAILED DAMAGE				
(5) NOT RECONSTRUCTED				
COMPUTER PROGRAM SPECIFY: <u>WINSMAH</u>				

Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L
1	BEGINS AT LFBC 132 CM	BC TO BC
2	BEGINS AT RE WHEEL 106	N/A

MAX CRUSH FOR FRONTAL IMPACT IS 19cm FROM C2

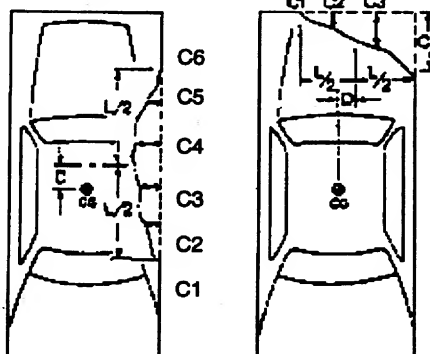

(1) Bumper
(2) Above Bumper
(3) Sill
(4) Above Sill
(5) Other _____
(9) Unknown

DL _____

UDL

CRUSH PROFILE IN CENTIMETERS

NOTE: Each line in the table below is a separate record (card).



Duplicate columns 1 - 12 for each completed line.

[illegible]

Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L

NO
INSPECTION

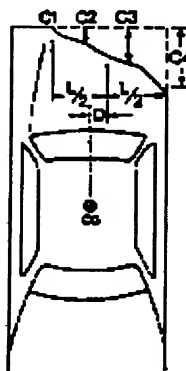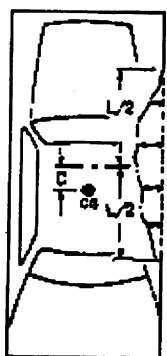

(1) Bumper
(2) Above Bumper
(3) Sill
(4) Above Sill
(5) Other _____
(9) Unknown

DL _____
UDL _____

CRUSH PROFILE IN CENTIMETERS

Duplicate columns 1 - 12 for each completed line.

[illegible]

Duplicate columns 1-8
from the previous card.Module W T Format 0 1
9 10 11 12

WHEELS AND TIRES

WT-1

WHEELS--DAMAGED

- (0) NO
(1) YES
(9) UNKNOWN

LF

0
13

RF

0

RR

0

FLAT LR

0
18

TIRE TREAD TYPE

- (1) REGULAR
(2) SNOW
(3) SLICKS
(4) ALL WEATHER (MS)
(7) OTHER: _____
(9) UNKNOWN

LF

4
17

RF

4

RR

4

LR

4
20

CARCASS CONSTRUCTION

- (1) BIAS
(2) BELTED BIAS
(3) RADIAL
(4) ELLIPTICAL
(5) HI PRESSURE SPARE
(6) SPACE SAVER SPARE
(7) OTHER: _____
(9) UNKNOWN

LF

3
21

RF

3

RR

3

LR

3
24

SIZE (NOT DOT CODE. IF UNKNOWN, USE 9'S)

LF

P195-70R14
25

RF

35

RR

45

LR

55



IF VEHICLE IS EQUIPPED WITH DUAL
WHEELS, COMPLETE FOR OUTER WHEELS
AND MAKE NOTES ON INNER WHEELS.

NOTES: _____

Duplicate columns 1-8
from the previous card.

Module F T Format 0 1
9 10 11 12

FUEL AND FUEL TANKS FT-1

TYPE OF PROPULSIVE FUEL (1) GASOLINE (2) DIESEL OIL (3) LPG (4) ELECTRIC (7) OTHER: _____ (9) UNKNOWN	<u>1</u> 13	AUXILIARY TANK TYPE (1) OEM TANK (2) AFTER MARKET TANK (8) NOT APPLICABLE (NOT EQUIPPED) (9) UNKNOWN	<u>8</u> 21
MAIN TANK LOCATION	<u>322</u> 14 16	AUXILIARY TANK LOCATION	<u>888</u> 22 24
MAIN FILLER CAP LOCATION	<u>113</u> 17 19	AUXILIARY FILLER CAP LOCATION	<u>888</u> 25 27
MAIN TANK MATERIAL <u>cc</u>	<u>9</u> 20	AUXILIARY TANK MATERIAL	<u>8</u> 28

TANK AND FILLER CAP LOCATION CODES

FIRST DIGIT (LONGITUDINAL)

- (1) BEHIND KICK-UP
- (2) IN KICK-UP
- (3) BETWEEN KICK-UP & COWL
- (4) FORWARD OF COWL
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

SECOND DIGIT (LATERAL)

- (1) LEFT OF FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) RIGHT OF FRAME
- (4) DUAL, RIGHT & LEFT TANKS
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

THIRD DIGIT (VERTICAL)

- (1) BELOW FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) ABOVE FRAME
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

TANK MATERIAL CODES

- (1) STEEL
- (2) ALUMINUM
- (3) PLASTIC
- (7) OTHER
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module F L Format 0 1
9 10 11 12

FUEL LEAKAGE FL-1

DID FUEL LEAKAGE RESULT FROM A CRASH EVENT

(0) NO KNOWN LEAKAGE SKIP PAGE.

(1) YES COMPLETE PAGE.

0
13

LEAK NUMBER	I LEAKING COMPONENT	II COMPONENT SOURCE	III TYPE OF DAMAGE	IV SEVERITY OF DAMAGE	V LOCATION OF LEAK	EVENT NUMBER
#1	<u>14</u> <u>15</u>	—	—	—	— —	<u>21</u>
#2	<u>22</u> <u>23</u>	—	—	—	— —	<u>29</u>
#3	<u>30</u> <u>31</u>	—	—	—	— —	<u>37</u>
#4	<u>38</u> <u>39</u>	—	—	—	— —	<u>45</u>
#5	<u>46</u> <u>47</u>	—	—	—	— —	<u>53</u>

I LEAKING COMPONENT

TANK AREA

- (11) MAIN FUEL TANK (INCLUDING VAPOR RECOVERY DOME)
- (12) AUXILIARY FUEL TANK
- (13) MAIN TANK FILLER TUBE
- (14) MAIN TANK CAP (GAS CAP)
- (15) AUXILIARY TANK FILLER TUBE
- (16) AUXILIARY TANK CAP (GAS CAP)
- (19) TANK AREA, DETAILS UNKNOWN

DELIVERY SYSTEM

- (21) FUEL FEED LINE (MAIN TANK TO FUEL PUMP)
- (22) FUEL FEED LINE (AUXILIARY TANK TO FUEL PUMP)
- (23) FUEL RETURN LINE (FUEL PUMP TO TANK)
- (24) INLINE FUEL FILTER
- (25) FUEL LINE (PUMP TO CARBURETOR OR INJECTOR PUMP)
- (26) CARBURETOR TO INJECTOR PUMP
- (27) FUEL PUMP
- (29) DELIVERY SYSTEM, DETAILS UNKNOWN

EVAPORATIVE EMISSION CONTROL SYSTEM

- (31) ATMOSPHERIC VENT PIPE (NON-EEC EQUIPPED)
- (32) EEC PIPE (VAPOR CANISTER TO CARBURETOR)

EEC SYSTEM (CONTINUED)

- (33) VAPOR RECOVERY HOSES (CANISTER TO CARBURETOR)
- (34) LIQUID-VAPOR SEPARATOR (UNLESS PART OF TANK)
- (35) CANISTER
- (39) EEC SYSTEM, DETAILS UNKNOWN

- (49) ENGINE COMPARTMENT, COMPONENT UNKNOWN
- (99) COMPONENT UNKNOWN

II COMPONENT SOURCE

- (1) OEM
- (2) AFTER MARKET
- (9) UNKNOWN

III TYPE OF DAMAGE

- (1) DENTED/CRUSHED
- (2) PUNCTURED
- (3) RUPTURED
- (4) SEVERED/GROSS TEARS
- (5) DISCONNECTED/DEFEATED
- (9) UNKNOWN

IV SEVERITY OF DAMAGE

- (1) MINOR
- (2) MODERATE
- (3) SEVERE
- (4) DISCONNECTED/DEFEATED
- (9) UNKNOWN

V LOCATION OF LEAK

FIRST DIGIT
(LONGITUDINAL LOCATION)

- (1) F, FORWARD OF COWL
- (2) P, BETWEEN COWL & REAR BULKHEAD
- (3) B, BEHIND REAR BULKHEAD
- (4) Y, F, & P
- (5) Z, P, & B
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

SECOND DIGIT
(LATERAL LOCATION)

- (1) L, LEFT
- (2) C, CENTER
- (3) R, RIGHT
- (4) Y, LEFT CENTER (L & C)
- (5) Z, RIGHT CENTER (R & C)
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

Duplicate columns 1-8
from the previous card.Module F R Format 0 1
9 10 11 12

FIRE FR-1

WAS THERE FIRE IN OR ON CASE VEHICLE?

(0) NO SKIP PAGE.(1) YES COMPLETE PAGE.

0

13

DID FIRE START IN CASE VEHICLE?

- (0) NO
- (1) YES
- (9) UNKNOWN

14

SEVERITY OF FIRE DAMAGE

- (1) MINOR
- (2) MODERATE
- (3) SEVERE
- (9) UNKNOWN

16

FLAME PROPOGATION RATE

- (1) RAPID/EXPLOSIVE
- (2) SLOW/MODERATE
- (9) UNKNOWN

15

DID AN INJURY TO CASE
VEHICLE OCCUPANT RESULT FROM
FIRE IN OR ON CASE VEHICLE?

- (0) NO
- (1) YES
- (9) UNKNOWN

17

PROVIDE NOTES IF FIRE OCCURRED.

Duplicate columns 1-8
from the previous card.

Module E D Format 0 1
9 10 11 12

EXTERIOR DAMAGE

ED-1

HOOD PERFORMANCE

FOR THE FOLLOWING, USE CODES:

- (0) NO
(1) YES
(8) NOT APPLICABLE
(9) UNKNOWN

HOOD LATCH(ES)- -RELEASED

0
13

-DAMAGED

1
14

-JAMMED

1
15

HOOD HINGES- -LEFT, DAMAGED

1
16

-LEFT, SEPARATED
(COMPLETE)

0
17

-RIGHT, DAMAGED

1
18

-RIGHT, SEPARATED
(COMPLETE)

0
19

HOOD REMAINED ON VEHICLE

1
20

REAR EDGE OF HOOD- -ELEVATED

1
21

-CONTACTED WINDSHIELD

0
22

-PENETRATED WINDSHIELD

8
23

HOOD LATCH LOCATION

- (1) FRONT OF VEHICLE
(2) COWL AREA
(3) SIDE
(8) NOT APPLICABLE
(9) UNKNOWN

1
24

STEERING COL FLEXIBLE COUPLING

FLEXIBLE COUPLING TYPE

- (0) NONE
(1) FLEXIBLE MATERIAL
(2) POT
(3) SINGLE U-JOINT
(4) DOUBLE U-JOINT
(5) FLEXIBLE CABLE
(6) COMBINATION OF ABOVE
(CIRCLE EACH)
(7) OTHER: _____
(8) EQUIPPED, TYPE UNKNOWN
(9) UNKNOWN, IF EQUIPPED

9
26

COUPLING- -DAMAGED

9
27

(USE CODES
FROM HOOD
PERFORMANCE)

-SEPARATED
(COMPLETE)

9
28

ENG COMPART TELESCOPING UNIT

TYPE OF UNIT

- (00) NONE INSTALLED
(01) - (07) SEE UNITS ON PAGE ED-2
(88) NOT COLLECTED
(97) OTHER: _____
(98) EQUIPPED, TYPE UNKNOWN
(99) UNKNOWN IF EQUIPPED

8 8
29 30

ORIGINAL LENGTH (mm)

F (OR H): _____

TELESCOPED LENGTH (mm)

G: _____

DIFFERENCE (mm)

F (OR H) - G

(IF LESS THAN 15mm, ENTER "000".)

- (888) NOT COLLECTED
(991) NOT MEASURED/NO
COMPRESSION
(992) COMPRESSED, AMOUNT
UNKNOWN
(993) DEVICE EXTENDED
(997) UNABLE TO BE MEASURED
(998) NOT APPLICABLE (NOT
EQUIPPED)
(999) UNKNOWN

8 8 8
31 32 33

ENGINE OR TRANSMISSION MOUNT

SEPARATION (COMPLETE)

- (0) NO
(1) YES
(9) UNKNOWN

0
25

EXTERIOR DAMAGE

ED-2

LEFT-SIDE BODY MOUNT

DID BODY MOUNT SEPARATE?

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

8
 34

LEFT DOORS

HOW DID DOORS
OPEN DURING COLLISION?

USE CODES:

(0) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (1) HINGE AREA SEPARATION
 (2) DOOR-LATCH SEPARATION
 (3) LATCH-STRIKER SEPARATION
 (4) STRIKER-PILLAR SEPARATION
 (5) BODY DISTORTION
 (6) COMBINATION OF ABOVE
 (CIRCLE EACH)
 (7) OPENED, REASON UNKNOWN

- (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

LEFT PILLARS

PILLARS SEPARATED COMPLETELY -

USE CODES:

- (0) NO
 (1) YES
 (4) NO SEPARATION, BUT DAMAGED
 (8) NOT APPLICABLE (NOT EQUIPPED)
 (9) UNKNOWN

-A-PILLAR, UPPER

0
 35

LOWER

0
 36

-B-PILLAR, UPPER

0
 37

LOWER

0
 38

-C-PILLAR, UPPER

0
 39

LOWER

0
 40

-D-PILLAR, UPPER

8
 41

LOWER

8
 42

-FRONT

0
 43

-REAR

0
 44

DOORS JAMMED CLOSED-

USE CODES:

- (0) NO
 (1) YES
 (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

-FRONT

0
 45

-REAR

0
 46

EXTERIOR DAMAGE

ED-3

REAR DOOR

REAR DOOR TYPE

- (0) NO DOOR (INCLUDES PICKUPS)
 (1) HATCHBACK
 (2) ONE-WAY TAILGATE
 (3) TWO-WAY TAILGATE
 (4) CLAMSHELL/DISAPPEARING TAILGATE
 (5) SINGLE DOOR
 (6) DOUBLE DOOR
 (9) UNKNOWN

Hatchback



One-way



Two-way



or



Clamshell



Single door



Double door



HOW DID DOOR OPEN DURING COLLISION?

- (0) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (1) HINGE AREA SEPARATION
 (2) DOOR-LATCH SEPARATION
 (3) LATCH-STRIKER SEPARATION
 (4) STRIKER-PILLAR SEPARATION
 (5) BODY DISTORTION
 (6) COMBINATION OF ABOVE (CIRCLE EACH)
 (7) OPENED, REASON UNKNOWN
 (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

DOOR JAMMED CLOSED

- (0) NO
 (1) YES
 (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

0
47

8
48

8
49

OTHER REAR DAMAGE

WAS PARTITION TO LUGGAGE AREA DAMAGED DURING COLLISION?

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

0
50

SPARE TIRE

- (0) NO SPARE TIRE
 (1) NOT ATTACHED BEFORE COLLISION
 (2) ATTACHED, NOT SEPARATED IN COLLISION
 (3) ATTACHED, SEPARATED DUE TO COLLISION
 (8) NOT COLLECTED
 (9) UNKNOWN

8
51

TRAILER HITCH TYPE

- (0) NO HITCH

BALL-AND-SOCKET TYPES

- (1) TEMPORARY FRAMEWORK (E.G. RENTAL CLAMP-ON)
 (2) BUMPER-MOUNT ONLY (E.G. LIGHT TRUCK)
 (3) BUMPER-AND-FRAME (BUT NON-EQUALIZING)
 (4) LOAD EQUALIZING

OTHER TYPES

- (5) RING-AND-PINTLE
 (6) FIFTH-WHEEL (INCL. P/U)
 (7) OTHER (E.G. CLEVIS-AND-PIN)

- (8) EQUIPPED, TYPE UNKNOWN
 (9) UNKNOWN IF EQUIPPED

0
52

TRAILER TYPE (AT TIME OF COLLISION)

- (0) NO TRAILER
 (1) TRAVEL-TRAILER/CAMPER
 (2) MOBILE HOME
 (3) BOAT/SNOWMOBILE/ATV TRAILER
 (4) UTILITY TRAILER
 (5) TOWED CAR
 (7) OTHER: _____
 (8) TRAILER, TYPE UNKNOWN
 (9) UNKNOWN

0
53

EXTERIOR DAMAGE

ED-4

RIGHT-SIDE BODY MOUNT

DID BODY MOUNT SEPARATE?

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

8
 54

RIGHT DOORS

HOW DID DOORS
OPEN DURING COLLISION?

USE CODES:

(00) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (01) HINGE AREA SEPARATION
 (02) DOOR-LATCH SEPARATION
 (03) LATCH-STRIKER SEPARATION
 (04) STRIKER-PILLAR SEPARATION
 (05) BODY DISTORTION
 (06) COMBINATION OF ABOVE
 (CIRCLE EACH)
 (07) OPENED, REASON UNKNOWN
 (11) VAN RIGHT-REAR DOOR OPENED
 (ANY MECHANISM)

- (98) NOT APPLICABLE (NO DOOR)
 (99) UNKNOWN

RIGHT PILLARS

PILLARS SEPARATED COMPLETELY -

USE CODES:

- (0) NO
 (1) YES
 (4) NO SEPARATION, BUT DAMAGED
 (8) NOT APPLICABLE (NOT EQUIPPED)
 (9) UNKNOWN

-A-PILLAR, UPPER

0
 55

LOWER

0
 56

-B-PILLAR, UPPER

0
 57

LOWER

0
 58

-C-PILLAR, UPPER

0
 59

LOWER

0
 60

-D-PILLAR, UPPER

8
 61

LOWER

8
 62

-FRONT

00
 63 64

-REAR

00
 65 66

DOORS JAMMED CLOSED-

USE CODES:

- (0) NO
 (1) YES
 (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

-FRONT

0
 67

-REAR

0
 68

VAN REAR DOOR TYPE

- (0) VAN, NO REAR DOOR
 (1) TRACK (SLIDING) - RIGHT SIDE
 (2) SINGLE-HINGED - RIGHT SIDE
 (3) DOUBLE-HINGED - RIGHT SIDE
 (4) TRACK (SLIDING) - RIGHT & LEFT SIDE
 (5) SINGLE-HINGED - RIGHT & LEFT SIDE
 (6) DOUBLE-HINGED - RIGHT & LEFT SIDE
 (7) TRACK AND HINGED COMBINATION
 (8) NOT APPLICABLE (NOT A VAN)
 (9) UNKNOWN

8
 69

EXTERIOR DAMAGE

ED-5

WINDSHIELD DAMAGE

WINDSHIELD CRACKED

- (0) NO
(1) YES
(8) NOT APPLICABLE
(9) UNKNOWN

WINDSHIELD BROKEN
(PLASTIC INTERLAYER TORN)

- (0) NO
(1) YES
(8) NOT APPLICABLE
(9) UNKNOWN

CRACKED OR BROKEN
BY OCCUPANT CONTACT

- (0) NO
(1) YES
(8) NOT APPLICABLE
(9) UNKNOWN

EXTENT OF BOND SEPARATION

- (0) NONE
(1) 1 - 20%
(2) 21 - 40
(3) 41 - 60
(4) 61 - 80
(5) 81 - 99
(6) TOTAL
(7) SEPARATED, AMOUNT
UNKNOWN
(8) NOT APPLICABLE
(9) UNKNOWN

WINDSHIELD MARK ON CASE VEHICLE:

TOYOTA

PPG

SOLARGREEN

DUPLATE

LAMINATED

SAFETY FLOAT

ASI

DOT

M

WINDSHIELD CODE

- (97) DESCRIBED BUT NOT CODED
(98) NOT APPLICABLE (NO WINDSHIELD)
(99) UNKNOWN

97
74 75


Roof

DID T-ROOF/SUN ROOF OPEN
DURING COLLISION?

- (0) NO
(1) YES
(8) NOT APPLICABLE
(NOT A T-ROOF OR SUN ROOF)
(9) UNKNOWN

8
76

LOCATE AREA OF WINDSHIELD INTEREST OR DAMAGE WITH DIMENSIONS (VERTICAL & HORIZONTAL) ON THIS DIAGRAM OF THE WINDSHIELD AS VIEWED FROM INSIDE.

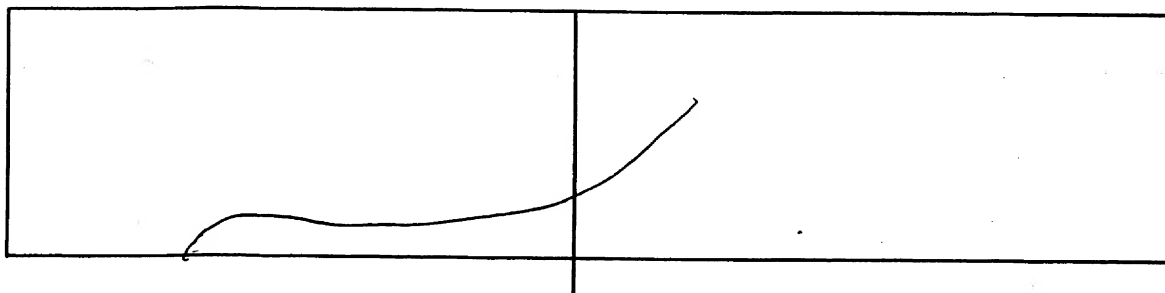COWL
DEFORMATION

L

C

R

Duplicate columns 1-8
from the previous card.Module S C Format 0 1
9 10 11 12

STEERING WHEEL AND COLUMN SC-1

STEERING WHEEL

STEERING WHEEL RIM DAMAGE

- (0) NONE
(1) DEFORMED SLIGHTLY
(2) SEVERELY BENT
(3) BROKEN
(9) UNKNOWN

NUMBER OF
STEERING WHEEL SPOKES

- (9) UNKNOWN

STEERING WHL SPOKE DAMAGE

- (0) NONE
(1) DEFORMED SLIGHTLY
(2) SEVERELY BENT
(3) BROKEN
(9) UNKNOWN

STEERING WHEEL POSITION
AT TIME OF COLLISION

IN WHAT O'CLOCK POSITION WAS THE
NORMAL TOP OF THE WHEEL POINTED
WHEN THE COLLISION OCCURRED?

EXAMPLES

O'CLOCK = 1 2O'CLOCK = 0 2

(NORMAL STRAIGHT
AHEAD)



O'CLOCK = 01

(99) UNKNOWN

STEERING WHEEL
ENERGY ABSORBING DEVICE

(1) EXAMPLES:



BARRACUDA, 70 - 74
CHALLENGER, 70 - 74
CAPRI, 71 - 77

(2) EXAMPLES:



OMNI, 78 -
HORIZON, 78 -

STEERING COLUMN OPTIONS

TILT FEATURE

- (0) NOT EQUIPPED
(1) YES, EQUIPPED, UNK POSITION
(2) UP
(3) MIDDLE
(4) LOWER
(9) UNKNOWN IF EQUIPPED

SWING-AWAY FEATURE

- (0) NOT EQUIPPED
(1) YES, EQUIPPED
(9) UNKNOWN IF EQUIPPED

TELESCOPING FEATURE

- (0) NOT EQUIPPED
(1) YES, EQUIPPED
(9) UNKNOWN IF EQUIPPED

TYPE OF DEVICE

- (0) NONE
(1) CONVOLUTED OR MESH CYLINDER
(2) DEEP DISH STEERING WHEEL
(7) OTHER: _____
(8) NOT COLLECTED
(9) UNKNOWN IF EQUIPPED

ORIGINAL DIMENSION (mm)

A: _____

DAMAGE DIMENSION (mm)

B: _____

DIFFERENCE (mm)

A - B

- (888) NOT COLLECTED
(991) NOT MEASURED/NO APPARENT
COMPRESSION
(992) COMPRESSED, AMOUNT UNKNOWN
(993) DEVICE EXTENDED
(997) UNABLE TO MEASURE
(998) NOT APPLICABLE (NOT EQUIPPED)
(999) UNKNOWN

8 8 8
20 22

STEERING WHEEL AND COLUMN SC-2

STEERING COLUMN
ENERGY ABSORBING DEVICE

TYPE OF DEVICE * (IF 27 OR 28)

- (00) NOT EQUIPPED
(88) NOT COLLECTED
(99) UNKNOWN

$$\frac{8}{23} \quad \frac{8}{24}$$

ORIGINAL LENGTH (mm)

C: _____

COMPRESSED LENGTH (mm)

D: _____

BRACKET DEFLECTION (IF CODE 36, 48,
OR 49 ABOVE)

OR

COMPRESSION (OR EXTRUSION) (mm)

C - D (OR E) (TOLERANCE: ± 10)

- (888) NOT COLLECTED
(991) NOT MEASURED/NO APPARENT
COMPRESSION
(992) COMPRESSED, AMOUNT UNKNOWN
(993) DEVICE EXTENDED
(997) UNABLE TO BE MEASURED
(998) NOT APPLICABLE (NOT EQUIPPED)
(999) UNKNOWN


$$\frac{8}{25} \quad \frac{8}{26} \quad \frac{8}{27}$$

* (ADD A & B FOR TOTAL COMPRESSION)

SHEAR CAPSULE SEPARATION (mm)

S (USE AVG. OF LEFT & RIGHT CAPSULES.)

LT:

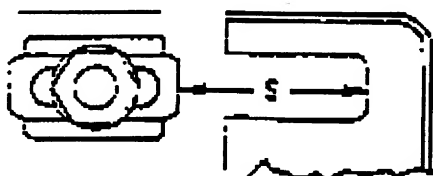

RT:

- (888) NOT COLLECTED
(991) NOT MEASURED/NO APPARENT
SEPARATION
(992) SEPARATED, AMOUNT UNKNOWN
(997) UNABLE TO BE MEASURED
(998) NOT APPLICABLE (NOT EQUIPPED)
(999) UNKNOWN

$$\frac{8}{28} \quad \frac{8}{29} \quad \frac{8}{30}$$

COLUMN VERTICAL ROTATION

- (0) NO APPARENT ROTATION
(1) UPWARD APPARENT ROTATION
(2) DOWNWARD APPARENT ROTATION
(9) UNKNOWN

$$\frac{0}{31}$$

COLUMN LATERAL ROTATION

- (0) NO APPARENT ROTATION
(1) LEFT APPARENT ROTATION
(2) RIGHT APPARENT ROTATION
(9) UNKNOWN

$$\frac{0}{32}$$

STEERING WHEEL (CONTINUED)

STEERING WHEEL HUB DAMAGE

- (0) NONE
(1) OCCUPANT CONTACT
(2) AIRBAG
(3) OTHER _____
(9) UNKNOWN

$$\frac{0}{33}$$

1 = Definitely 2 = Probably 3 = Possible

BEST AVAILABLE

INTRUSION IT-1


Location of Intrusion	Intruded Component	(All Measurements Are in Centimeters)			Dominant Crush Direction
		Comparison Value	– Intruded Value	= Intrusion	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	

OCCUPANT CONTACT WORKSHEET


Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	AIRBAG	1	FACE	BLACK MARKS ON TOP RIGHT	1
B	KNEE BOLSTER	1	KNEE	SCUFF (CENTER)	1
C	DOOR PANEL	2	LEG	BLACK MARKS	2
D					
E					
F					
G					
H					
I					
J					
K					

INTRUSION IT-2

VEHICLE OCCUPANT CONTACT DIAGRAM

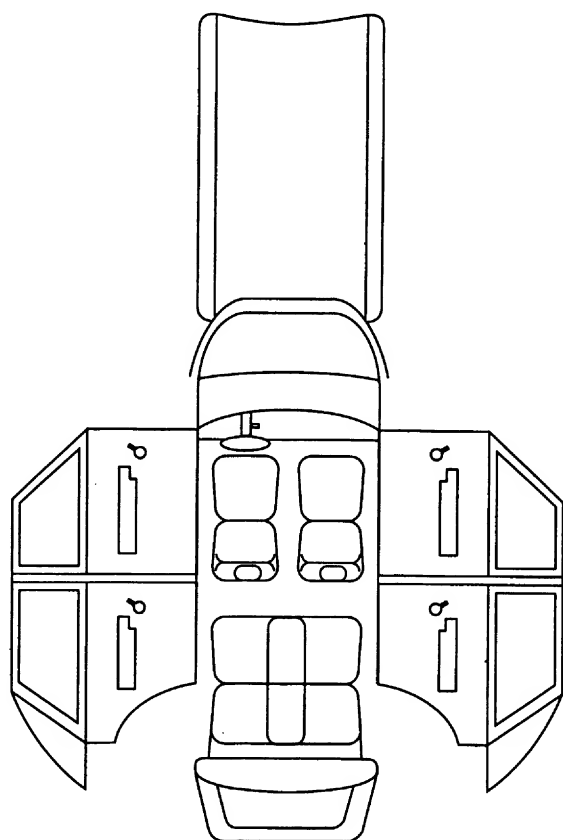


Ⓐ AIRBAG

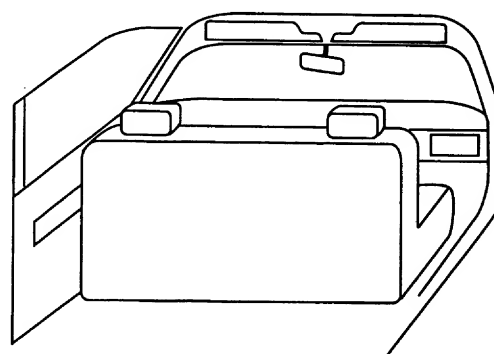

DR BELT: UP-POSITION ON B-PILLAR.
WEBBING LOCKED IN EXTENDED
POSITION. MARKS ON D-RING AND
SHOULDER-BELT WEBBING
DEFINITE USE.

RF BELT: UP-POSITION ON B-PILLAR.
WEBBING LOCKED IN EXTENDED
POSITION. MARKS ON D-RING AND
SHOULDER-BELT WEBBING
DEFINITE USE.

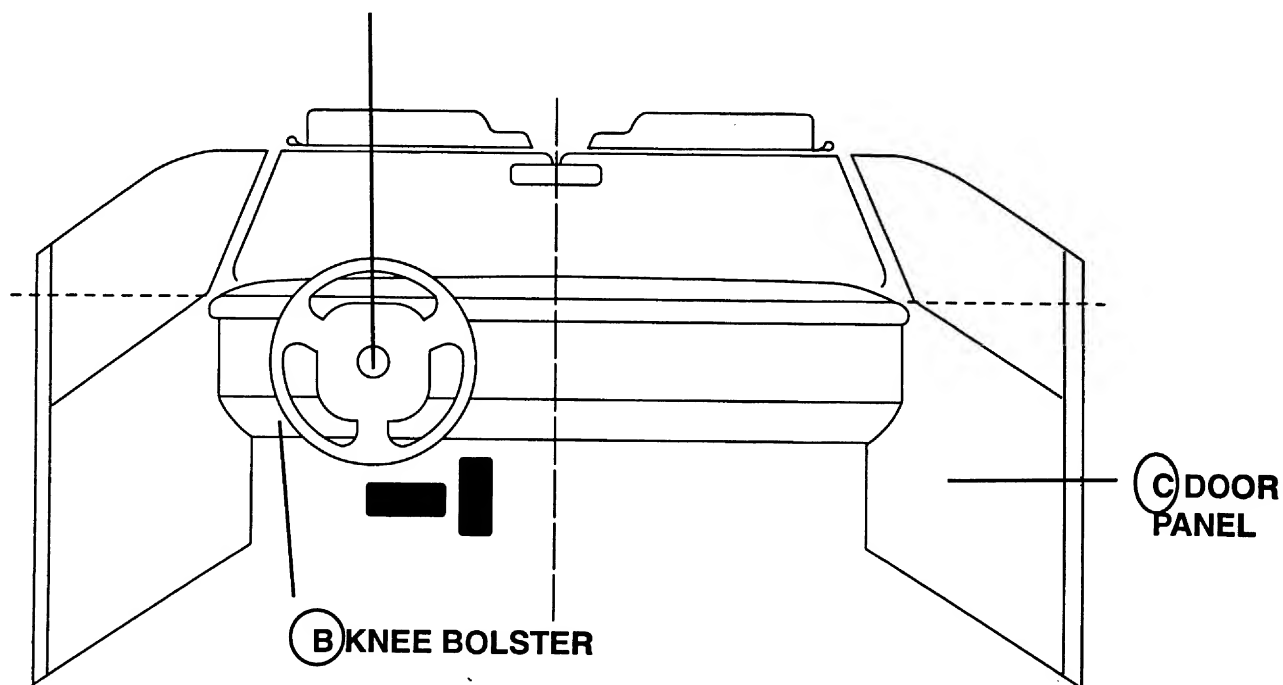

Ⓑ KNEE BOLSTER

Ⓒ DOOR
PANEL

INTRUSION IT-3

CODES FOR COLUMN B, OCCUPANT SPACE NUMBER

OCCUPANT SPACE NUMBER IS A TWO-DIGIT CODE. THE USE OF THE CODE IS DETERMINED BY THE VEHICLE SEAT CONFIGURATION AT THE TIME OF THE ACCIDENT.

FIRST DIGIT

THE FIRST DIGIT (LEFT DIGIT) DENOTES THE SEAT ROW, WITH CODE VALUES FROM 1 TO 5.

SECOND DIGIT

THE SECOND DIGIT (RIGHT DIGIT) DENOTES THE POSITION ON THE SEAT AND, IN SOME INSTANCES, THE WIDTH OF THE SEAT.

- (1) LEFT (3) RIGHT INDIVIDUAL SEAT
- (1) LEFT (2) CENTER (3) RIGHT BENCH: FULL WIDTH 3 PASSENGER
- (1) LEFT (2) LEFT CENTER (6) RIGHT CENTER (3) RIGHT BENCH: FULL WIDTH 4 PASSENGER
- (1) LEFT (2) CENTER (5) RIGHT & BENCH: PARTIAL WIDTH, LEFT AISLE SPACE
- (0) LEFT & SPACE (2) CENTER (5) RIGHT & BENCH: PARTIAL WIDTH, CENTERED SPACE
- (4) ENTIRE VEHICLE WIDTH CARGO AREA

EXAMPLES

THE TWO FIGURES BELOW PROVIDE EXAMPLES OF THE OCCUPANT SPACE NUMBER.

PASSENGER CAR
5 PASSENGERS

X	X	11	13
X	X	21	22 23

VAN
12 PASSENGER CAPACITY

X	X	11	13
X	X	X	21 22 25
X	X	X	31 32 35
X	X	X	X 41 42 46 43

CODES FOR COLUMN F, MEASUREMENT AXIS

- (X) X-AXIS (FORE & AFT)
(Y) Y-AXIS (LATERAL)
(Z) Z-AXIS (VERTICAL)

CODES FOR COLUMNS G, H, I & J, OCCUPANT & INJURY NUMBERS

OCCUPANT NUMBER	INJURY NUMBER	CONTACT
(00)	(00)	NO CONTACT
(##)	(00)	CONTACT, NO INJURY
(97)	(99)	CONTACT, OCCUPANT UNKNOWN, INJURY UNKNOWN
(99)	(00) OR (99)	UNKNOWN IF CONTACT

INTRUSION IT-4

CODES FOR COLUMN C, INTRUDING COMPONENT OR OBJECT

NOTE: DO NOT CODE OBJECTS OTHER THAN COMPONENTS OF CASE VEHICLE.

INDIVIDUAL COMPONENT

INTERNAL

- (01) INSTRUMENT PANEL
- (02) FIRE WALL
- (03) TOE PAN
- (04) FLOOR PAN
- (05) STEERING COLUMN
- (06) WINDSHIELD
- (07) WINDSHIELD HEADER
- (08) A-PILLAR
- (09) DOOR PANEL OR SIDE PANEL
- (10) WINDOW FRAME
- (11) B-PILLAR
- (12) C-PILLAR
- (13) D-PILLAR
- (14) ROOF SIDE RAILS
- (15) ROOF OR CONVERTIBLE TOP
- (16) BACKLIGHT HEADER
- (17) FRONT SEAT-BACK SURFACE/
SEAT-BACK BACK SURFACE
- (18) SECOND SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (19) THIRD SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (20) FOURTH SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (21) FIFTH SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (22) BACK PANEL/BACK DOOR SURFACE
- (23) SEAT CUSHION SURFACE/EDGE
- (24) CONSOLE
- (25) OTHER (DESCRIBE)
- (26) UNKNOWN INTERNAL SURFACES
- (28) TRANSMISSION TUNNEL (HUMP)
- (29) SIDE FOOTWELL PANEL (KICKPANEL)
- (30) SILL

EXTERNAL

- (43) HOOD
- (44) OBJECT EXTERNAL TO PASSENGER
COMPARTMENT BUT PART
OF CASE VEHICLE
- (45) OUTSIDE SURFACE OF CASE VEHICLE
- (46) OTHER (E.G. SPARE TIRE,
JACK. DESCRIBE.)
- (49) UNKNOWN EXTERNAL OBJECT

GROUPED FOR MASSIVE INTRUSION INTO AN OCCUPANT SPACE

USE ONLY IF ALL THESE COMPONENTS
INTRUDED INTO A SINGLE OCCUPANT SPACE.

- | | |
|------------------------|-------------------------|
| (50) WINDSHIELD HEADER | (60) ROOF |
| A-PILLAR | ROOF RAIL |
| ROOF SIDE RAIL | A-PILLAR |
| (51) INSTRUMENT PANEL | B-PILLAR |
| A-PILLAR | C-PILLAR |
| DOOR PANEL | WINDOW FRAME |
| (52) INSTRUMENT PANEL | DOOR PANEL |
| A-PILLAR | FLOOR PAN |
| WINDSHIELD HEADER | (61) INSTRUMENT PANEL |
| (53) DOOR PANEL | TOE PAN |
| B-PILLAR | WINDSHIELD HEADER |
| ROOF RAIL | A-PILLAR |
| (54) DOOR PANEL | ROOF RAIL |
| A-PILLAR | WINDOW FRAME |
| ROOF RAIL | DOOR PANEL |
| (55) INSTRUMENT PANEL | ROOF |
| FLOOR PAN | (62) ROOF |
| A-PILLAR | ROOF RAIL |
| DOOR FRAME | C-PILLAR |
| (56) ROOF RAIL | WINDOW FRAME |
| A-PILLAR | FLOOR PAN |
| B-PILLAR | SECOND SEAT |
| WINDOW FRAME | DOOR PANEL |
| (57) ROOF RAIL | (63) ROOF RAIL |
| A-PILLAR | ROOF |
| B-PILLAR | B-PILLAR |
| C-PILLAR | WINDOW FRAME |
| DOOR PANEL | FLOOR PAN |
| (58) ROOF | DOOR PANEL |
| ROOF RAIL | SECOND SEAT |
| WINDOW FRAME | FRONT SEAT |
| DOOR PANEL | (64) ROOF RAIL |
| (59) BACKLIGHT HEADER | ROOF OR CONVERTIBLE TOP |
| ROOF | A-PILLAR |
| C-PILLAR | B-PILLAR |
| THIRD SEAT-BACK | WINDOW FRAME |
| | WINDOW HEADER |
| | (65) WINDSHIELD |
| | WINDSHIELD HEADER |
| | ROOF SIDE RAIL |
| | (66) WINDSHIELD |
| | WINDSHIELD HEADER |
| | A-PILLAR |
| | (98) NOT APPLICABLE |
| | (99) UNKNOWN |

Duplicate columns 1-8
from the previous card.Module 1 1 Format 0 1
9 10 11 12

INTRUSION IT-5

WAS THERE OCCUPANT COMPARTMENT INTRUSION? 0
13

- (0) NO DO NOT ANSWER NEXT QUESTION. SKIP PAGE.
 (1) YES ANSWER NEXT QUESTION.
 (9) UNKNOWN SKIP PAGE.

WAS INTRUSION CATASTROPHIC? 14

- (0) NO COMPLETE PAGE.
 (1) YES SKIP PAGE.

Duplicate columns 1-8
from the previous card.Module 1 1 Format 0 2
9 10 11 12

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

INTRUSIONS CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.
 CODES FOR B, F, G, H, I, J ON PAGE IT-3
 CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

A	B	C	D	E	F	G	H	I	J	K
INTRUSION NUMBER	OCC. SPACE NO.	INTRUDING COMPONENT OR OBJECT	ASSOC. EVENT NO.	MAXIMUM INTRUSION X AXIS (cm)	MAXIMUM INTRUSION Y AXIS (cm)	MAXIMUM INTRUSION Z AXIS (cm)	OCCUPANT NUMBER	INJURY NUMBER	OCCUPANT NUMBER	INJURY NUMBER
13-14	15-16	17-18	19	20-21	22-23	24-25	26-27	28-29	30-31	32-33
<u>0 1</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 2</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 3</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 4</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 5</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 6</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 7</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —

NOTE: USE ADDITIONAL PAGE IF MORE THAN 7 INTRUSIONS.

Duplicate columns 1-8
from the previous card.Module 1 1 Format 0 3
9 10 11 12NOTE: IF NO SIDE DOOR INTRUSION,
SKIP REMAINDER OF PAGE.SIDE DOOR INTRUSION
RESULTED FROMINTRUSION
NUMBER CAUSECODES
FOR CAUSE:

13 15 (1) DIRECT
18 18 IMPACT
19 21 (2) INDUCED
 (9) UNKNOWN DAMAGE

IF DAMAGE TO DOOR COMPONENT RESULTED IN INCREASED
DOOR INTRUSION, CODE COMPONENTINTRUSION
NUMBERDAMAGED
COMPONENT 1DAMAGED
COMPONENT 2CODES
FOR COMPONENTSA 22 2325B 26 2729C 30 3133D 34 3537

- (0) NONE
 (1) A-PILLAR
 (2) B-PILLAR
 (3) C-PILLAR
 (4) LATCH/STRIKER
 (5) HINGES
 (7) OTHER:
 (8) NOT APPLICABLE
 (9) UNKNOWN

**Duplicate columns 1-8
from the previous card.**

Module 1 T Format 0 2
9 10 11 12

INTRUSION IT-6

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

-- ADDITIONAL PAGE --

INTRUSIONS CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.
CODES FOR B, F, G, H, I, J ON PAGE IT-3
CODES FOR C ON PAGE IT-4

A	B	C	D	E	F	G	H	I	J	K
INTRUSION NUMBER	OCC. SPACE NO.	INTRUDING COMPONENT OR OBJECT	ASSOC. EVENT NO.	MAXIMUM INTRUSION X AXIS (cm)	MAXIMUM INTRUSION Y AXIS (cm)	MAXIMUM INTRUSION Z AXIS (cm)	OCCUPANT NUMBER	INJURY NUMBER	OCCUPANT NUMBER	INJURY NUMBER
13-14	15-16	17-18	19	20-21	22-23	24-25	26-27	28-29	30-31	32-33
0 8	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
0 9	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
1 0	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
1 1	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
1 2	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
1 3	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
1 4	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
1 5	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
1 6	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
1 7	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
1 8	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
1 9	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
2 0	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
2 1	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
2 2	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
2 3	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
2 4	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
2 5	— —	— —	—	— —	— —	— —	— —	— —	— —	— —

Duplicate columns 1-8
from the previous card.Module 1 D Format 0 1
9 10 11 12

INTERIOR DAMAGE

ID-1

CODES:

- (0) NO
(1) YES
(3) NO, and OCCUPANT CONTACT

- (4) YES, and OCCUPANT CONTACT
(8) NOT APPLICABLE
(9) UNKNOWN

	LEFT	RIGHT				
SIDES			FRONT		INSTRUMENT PANEL	
FRONT DOOR	0	3	FOOT CONTROLS	0	UPPER PANEL	0
FRONT HARDWARE	13	14	IGNITION KEYS	45	MID PANEL	55
FRONT ARMREST	15	16	REAR VIEW MIRROR	46	LOWER PANEL	56
FRONT GLASS	17	18	SUNVISOR/FITTINGS	47	ASHTRAY	57
REAR DOOR AREA	19	20	(5) LEFT SIDE ONLY (6) RIGHT SIDE ONLY (7) BOTH SIDES	48	CONTROL KNOBS & LEVERS	58
REAR HARDWARE	21	22	WINDSHIELD TOP MOLDINGS	49	GLOVE COMPARTMENT AREA	59
REAR ARMREST	23	24	LEFT A-PILLAR (UPPER OR LOWER)	50	INSTRUMENTS	60
REAR GLASS	25	26	RIGHT A-PILLAR (UPPER OR LOWER)	51	PARKING BRAKE RELEASE	61
ROOF SIDE RAIL	27	28	CENTER CONSOLE	52	PARKING BRAKE PEDAL	62
B-PILLAR	29	30	TRANSMISSION SELECTOR LEVER	53	A/C OR UPPER VENT OUTLETS	63
C-PILLAR	31	32	RIM, HORN, SPOKE	54	HEATER OR A/C DUCTS	64
D-PILLAR	33	34			RADIO	65
HEADLINING	35	36			OTHER: *	66
ROOF STRUCTURE	37	38				67
T-ROOF/SUN ROOF	39	40				
OTHER: *	41	42				
	43	44				
					REAR	
					WINDOW	0
					WINDOW HEADER	88
					CONSOLES	
					VERTICAL	0
					ROOF	70
						71

* MORE THAN ONE ITEM MAY BE NOTED.

Duplicate columns 1-8 from the previous card.		Module <u>S</u> <u>I</u> Format <u>0</u> <u>2</u> 9 10 11 12		SEATS		ST-1	
FRONT SEAT		DRIVER		PASSENGER		FRONT SEAT-BACK	
TYPE OF FRONT SEAT (00) NO SEAT (01) STANDARD BENCH (02) SPLIT BACK, 50-50 (03) SPLIT BACK, DRIVER WIDE (04) SPLIT BACK, PASS. WIDE (05) BUCKET (06) CAPTAIN'S CHAIR (07) INDIV. BENCH, 50-50 (08) INDIV. BENCH, DRIVER WIDE (09) INDIV. BENCH, PASS. WIDE (97) OTHER: _____ (99) UNKNOWN		DRIVER: <u>05</u> 13 14		PASSENGER: <u>05</u> 15 16		SEAT-BACK TYPE (1) FORWARD FOLDING (2) RIGID (3) RECLINING (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN	
TYPE OF SEAT MOUNT (1) STANDARD (2) PEDESTAL (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		DRIVER: <u>1</u> 17		PASSENGER: <u>1</u> 18		SEAT-BACK LOCK TYPE (0) NONE (1) MANUAL (2) INERTIA (3) POWER (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN	
SWIVEL MECHANISM EQUIPPED (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		DRIVER: <u>0</u> 19		PASSENGER: <u>0</u> 20		LOCKS HELD (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN	
ORIGINAL EQUIPMENT SEATS (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		DRIVER: <u>1</u> 21		PASSENGER: <u>1</u> 22		RECLINER MECHANISM HELD (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN	
CONTACT OF SEAT BY REAR OCCUPANT (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		DRIVER: <u>8</u> 23		PASSENGER: <u>8</u> 24			
FRONT SEAT DAMAGE (0) NONE (1) BACKREST ONLY DAMAGED (2) CUSHION ONLY DAMAGED (3) BACKREST & CUSHION DAMAGED (8) NOT APPLICABLE (9) UNKNOWN		DRIVER: <u>0</u> 25		PASSENGER: <u>0</u> 26		HEAD RESTRAINT HEAD RESTRAINT TYPE (0) NONE (1) ADJUSTABLE (2) INTEGRAL (3) NOT INTEGRAL, BUT CANNOT BE REMOVED (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN	
CENTER ARMREST DAMAGED (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE (NO CENTER ARMREST) (9) UNKNOWN IF EQUIPPED		DRIVER: <u>0</u> 27				REMOVED PRE-CRASH (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN	
FRONT SEAT ROTATION (0) NONE APPARENT (1) FORWARD APPARENT (2) REARWARD APPARENT (3) LEFT APPARENT (4) RIGHT APPARENT (5) MULTIPLE ROTATIONS SPECIFY _____ (8) NOT APPLICABLE (9) UNKNOWN		DRIVER: <u>0</u> 28		PASSENGER: <u>0</u> 29		ADJUSTMENT AT CRASH (1) UP (2) DOWN (8) NOT APPLICABLE (9) UNKNOWN	
						HEAD RESTRAINT DAMAGE (0) NONE (1) DAMAGED BUT NOT SEPARATED (2) SEPARATED (8) NOT APPLICABLE (9) UNKNOWN	

FRONT SEAT ADJUSTMENT		DRIVER	PASSENGER	SECOND SEAT (CONT.)	
SEAT ADJUSTMENT TYPE (0) NONE (RIGID) (1) MANUAL (2) POWER (7) OTHER: _____ (8) NOT APPLICABLE (NO SEAT) (9) UNKNOWN		<u>1</u> 46	<u>1</u> 47	CENTER ARMREST DAMAGED (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE (NO CENTER ARMREST) (9) UNKNOWN IF EQUIPPED	
ADJUSTMENT PROVIDED (1) 2-WAY (2) 4-WAY (3) 6-WAY (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 48	<u>1</u> 49	SECOND SEAT-BACK LOCKS FOR THE FOLLOWING, USE: (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN	
SEAT ADJUSTER DAMAGE (0) NONE (1) CHUCKING (FREE PLAY) (2) DEFORMED (RELEASED/JAMMED) (3) SEPARATED (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 50	<u>0</u> 51	LEFT OR CENTER, EQUIPPED <u>1</u> 61	
SEAT ADJUSTER SEPARATION (0) NONE (1) SEPARATED AT FLOOR (2) SEPARATION OF ADJUSTER (3) SEPARATED AT SEAT (8) NOT APPLICABLE (9) UNKNOWN		<u>8</u> 52	<u>8</u> 53	LEFT OR CENTER, HELD (3) SEAT FOLDED DOWN <u>1</u> 63	
PRE-CRASH POSITION (1) FORWARD (2) MIDDLE (3) REARWARD (8) NOT APPLICABLE (9) UNKNOWN		<u>2</u> 54	<u>3</u> 55	RIGHT, EQUIPPED <u>0</u> 65	
SECOND SEAT TYPE OF SECOND SEAT (0) NONE (1) NON-FOLDING (2) FOLDING (3) CAPTAIN'S CHAIR (4) JUMP SEAT (5) INTEGRAL CHILD SEAT (6) LUGGAGE AREA ACCESS PANEL (9) UNKNOWN		<u>2</u> 56	<u>2</u> 57	RIGHT, HELD (3) SEAT FOLDED DOWN <u>1</u> 66	
SECOND SEAT DAMAGE (0) NONE (1) BACKREST ONLY (DAMAGED OR LOOSENED) (2) CUSHION ONLY (DAMAGED OR LOOSENED) (3) BACKREST & CUSHION (DAMAGED OR LOOSENED) (4) INTEGRAL CHILD SEAT (PRIORITY CODE) (5) LUGGAGE AREA ACCESS PANEL (DAMAGED OR LOOSENED) (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 58	<u>0</u> 59	THIRD SEAT EQUIPPED BACKREST DAMAGED CUSHION DAMAGED	
				VEHICLE EQUIPPED WITH REAR HEAD RESTRAINTS (0) NOT EQUIPPED (OR REMOVED) (1) EQUIPPED (2) EQUIPPED & DAMAGED (8) NOT APPLICABLE (NO REAR SEAT) (9) UNKNOWN <i>Applies to any rear-seat position</i>	

Both Forward AT inspection note

3-pr

Duplicate columns 1-8
from the previous card.

Module A B Format 0 1
9 10 11 12

AIRBAG AB-1

<p>DRIVER SIDE</p> <p>LOCATION OF AIRBAG</p> <p>STEERING WHEEL</p> <p>EQUIPPED</p> <p>(0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>DEPLOYED</p> <p>(0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 13</p> <p><u>1</u> 14</p>	<p>PASSENGER SIDE</p> <p>LOCATION OF AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>EQUIPPED</p> <p>(0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>DEPLOYED</p> <p>(0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 16</p> <p><u>1</u> 17</p>
<p>CONDITION OF AIRBAG</p> <p>STEERING WHEEL</p> <p>(0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER _____ (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION</p>	<p><u>0</u> 15</p>	<p>CONDITION OF AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>(0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER _____ (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION</p>	<p><u>0</u> 18</p>
<p>DRIVER SIDE</p> <p>AIRBAG</p> <p>STEERING WHEEL</p> <p>TETHER</p> <p>(0) NO (1) YES (6) OTHER _____ (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>MARKED BY CONTACT</p> <p>(0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 19</p> <p><u>1</u> 20</p>	<p>PASSENGER SIDE</p> <p>AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>TETHER</p> <p>(0) NO (1) YES (6) OTHER _____ (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>MARKED BY CONTACT</p> <p>(0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 21</p> <p><u>0</u> 22</p>


AIRBAG NUMBER ON DRIVER SIDE:

[REDACTED]


ASSEMBLED IN MEXICO
WITH USA COMPONENT

NOTE AND DESCRIBE ANY AIRBAG CONTACT OR

Driver Airbag

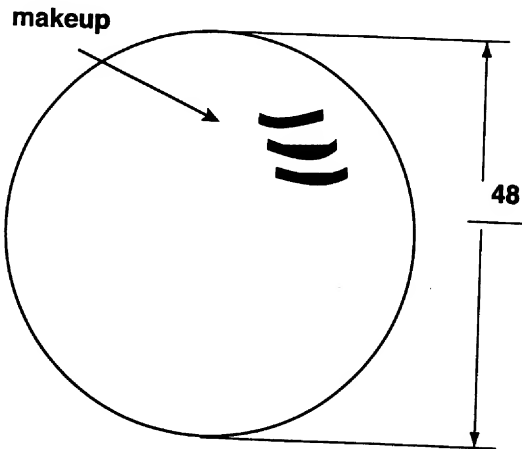

Driver Airbag Doors

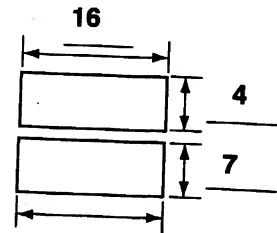

H-Pattern


Vents: ☒ Y ☐ N
if yes, how many: 2

Tethers: ☒ Y ☐ N
if yes, how many: 1

AIRBAG NUMBER ON PASSENGER SIDE:

NOTE AND DESCRIBE ANY AIRBAG CONTACT OR
DAMAGE ON DIAGRAM BELOW:

NO
VENTS

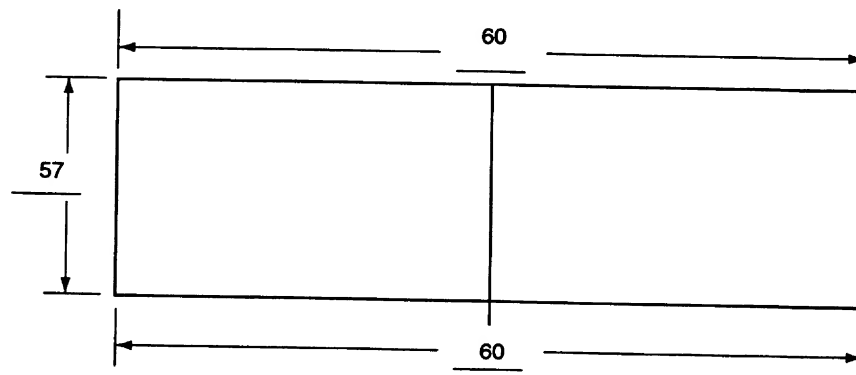

NOTE TO THE INVESTIGATOR:

THE FOLLOWING TWO SECTIONS,
OCCUPANT INFORMATION AND INJURY CLASSIFICATION,
ARE TO BE FILLED IN
FOR EACH CASE VEHICLE OCCUPANT,
WHETHER INJURED OR NOT.

IF THERE IS MORE THAN ONE OCCUPANT,
USE ADDITIONAL COPIES
OF PAGES OC-1, OC-2, OC-3,
AND IC-2 TO DESCRIBE THEM
AND ATTACH THE COPIES TO THIS REPORT.

Duplicate columns 1-8
from the previous card.Module 0 C Format 0 2
9 10 11 12

OCCUPANT INFORMATION OC-1

OCCUPANT IDENTIFICATION

OCCUPANT NUMBER

01
13 14

ROLE OF OCCUPANT AT 1ST IMPACT

- (1) MOTOR VEHICLE DRIVER
(2) MOTOR VEHICLE PASSENGER
(NOT DRIVER)
(9) UNKNOWN

1
15

PHYSICAL DESCRIPTION

AGE IN YEARS

- (00) LESS THAN 1 YEAR
(98) 98 YEARS OR OLDER
(99) UNKNOWN

37
20 21

AGE IN MONTHS

- (00) LESS THAN 1 MONTH
(25) 25 MONTHS OR OLDER
(99) UNKNOWN

25
22 23

MASS (kg)

- (999) UNKNOWN

150068
24 25 26

HEIGHT (cm)

- (999) UNKNOWN

5'5165
27 28 29

SEX

- (1) MALE
(2) FEMALE
(9) UNKNOWN

2
30

OCCUPANT POSITION

ROW LOCATION

- (1) FRONT
(2) SECOND
(3) THIRD
(4) FOURTH
(7) OTHER: _____
(8) EXTERNAL TO PASSENGER
COMPARTMENT (E.G. BED OF PICKUP)
(9) UNKNOWN

1
16

LATERAL LOCATION

- (1) LEFT
(2) LEFT CENTER
(3) CENTER
(4) RIGHT CENTER
(5) RIGHT
(6) ALL (LYING ON SEAT)
(8) EXTERNAL TO PASSENGER
COMPARTMENT
(9) UNKNOWN

1
17

POSTURE

- (10) SITTING ON SEAT
(11) SITTING ON SEAT IN ABNORMAL
POSITION (E.G. FEET ON DASH,
SIDEWAYS)
(12) SITTING ON CONSOLE
(20) ON LAP OR IN ARMS
(30) STANDING ON SEAT
(40) STANDING ON FLOOR
(47) STANDING, EXTERNAL TO
PASSENGER COMPARTMENT
(50) IN BASSINET
(60) IN CHILD SEAT
(65) IN CHILD HARNESS
(70) LYING ON SEAT
(80) LYING/SITTING ON PASSENGER
FLOOR
(83) LYING/SITTING ON OTHER
OBJECT IN PASSENGER
COMPARTMENT: _____
(85) ON CARGO FLOOR/FOLDED
SEAT-BACK
(87) LYING/SITTING, EXTERNAL TO
PASSENGER COMPARTMENT
(97) OTHER: _____
(99) UNKNOWN

10
18 19

MEDICAL CONDITIONS

TREATMENT/MORTALITY

- (00) NONE
(01) FIRST AID AT SCENE
(02) TREATED AT HOSPITAL/CLINIC
BUT NOT ADMITTED
(03) HOSPITALIZED FOR OBSERVATION
LESS THAN 24 HOURS
(04) HOSPITALIZED OVER 24 HOURS
OR FOR SIGNIFICANT TREATMENT
(05) FATAL, DEAD AT SCENE
(06) FATAL, DOA
(07) FATAL, DEAD WITHIN 24 HOURS
(08) FATAL, DEAD 24 HOURS TO
31 DAYS LATER
(09) FATAL, DEAD 31 DAYS TO
1 YEAR LATER
(10) FATAL DEAD WITHIN UNKNOWN
PERIOD
(99) UNKNOWN

02
31 32

INJURY SEVERITY SCORE (ISS)

- (99) UNKNOWN

02
33 34

NON-IMPACT MED. CONDITIONS

- (0) NONE
(1) YES, TIME & TYPE UNKNOWN
(2) PRE-CRASH FATAL (CLINICAL
DEATH AT WHEEL)
(3) PRE-CRASH NON-FATAL (E.G.
PRIOR INJURY, STROKE)
(4) PREGNANT
(5) POST-CRASH FATAL (DROWNING)
(6) POST-CRASH NON-FATAL INJURY
(7) OTHER: _____
(8) COMBINATION OF ABOVE
(CIRCLE EACH)
(9) UNKNOWN

0
35

OCCUPANT INFORMATION OC-2

MEDICAL CONDITIONS (CONT.)

POLICE INJURY SEVERITY
CODE FOR THIS OCCUPANT

- (0) O - NO INJURY
- (1) C - POSSIBLE INJURY
- (2) B - NON-INCAPACITATING
- (3) A - INCAPACITATING INJURY
- (4) K - FATAL
- (5) INJURED, SEVERITY UNKNOWN
- (6) DIED PRIOR TO IMPACT
- (7) NON-FATAL INJURY,
SEVERITY UNKNOWN
- (9) UNKNOWN

3
36

CHILD SEAT TYPE

- (00) NONE USED
- (01) YES, USED
- (02) INTEGRAL, Chrysler Mini-van
- (88) NOT APPLICABLE
(ADULT OR OLDER CHILD)
- (99) UNKNOWN

88
41 42

CHILD SEAT MAKE/MODEL

RESTRAINT SYSTEM

ACTIVE RESTRAINT SYSTEM

- (0) NONE
- (1) LAP BELT
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &
SHOULDER HARNESS
- (9) UNKNOWN

3
37

ACTIVE RESTRAINT SYSTEM USAGE

- (0) NONE (AVAILABLE BUT NOT USED)
- (1) LAP BELT ONLY
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &
SHOULDER HARNESS
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NONE AVAILABLE)
- (9) UNKNOWN

3
38

PASSIVE RESTRAINT SYSTEM

- (0) NONE
- (1) AIRBAG INSTALLED
- (2) PASSIVE UPPER TORSO
WITH KNEE BOLSTERS
- (3) PASSIVE UPPER TORSO
WITHOUT KNEE BOLSTERS
- (4) PASSIVE LAP & UPPER TORSO
- (5) AIRBAG INSTALLED &
PASSIVE RESTRAINT
- (7) OTHER: _____
- (9) UNKNOWN

1
39

PASSIVE RESTRAINT SYSTEM USAGE

- (0) SYSTEM DEFEATED
- (1) AIRBAG NOT DEPLOYED
- (2) AIRBAG DEPLOYED
- (3) AIRBAG NOT REINSTALLED
- (4) PASSIVE UPPER TORSO USED
- (5) PASSIVE LAP & UPPER TORSO USED
- (6) SYSTEM USED IN MANUAL MODE
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NOT ORIGINALLY
EQUIPPED)
- (9) UNKNOWN

2
40

EJECTION

DEGREE OF EJECTION

- (0) NONE
- (1) PARTIAL
- (2) COMPLETE
- (7) EJECTED, DEGREE UNKNOWN
- (9) UNKNOWN IF EJECTED

0
43

AREA OF EJECTION

- (01) WINDOW, LEFT SIDE
- (02) WINDOW, RIGHT SIDE
- (03) WINDOW, REAR
- (04) DOOR, LEFT SIDE
- (05) DOOR, RIGHT SIDE
- (06) DOOR, REAR OR TAILGATE
- (07) WINDSHIELD
- (08) ROOF OR OPEN CONVERTIBLE OR
FROM EXTERNAL AREA
- (96) EJECTED AREA UNKNOWN
- (97) OTHER AREA: _____
- (98) NOT APPLICABLE (NOT EJECTED)
- (99) UNKNOWN IF EJECTED

98
44 45
IF OCCUPANT WAS EJECTED, DESCRIBE
IN DETAIL BELOW:

HEAD RESTRAINT

HEAD RESTRAINT AVAILABLE
FOR THIS POSITION

- (0) NOT EQUIPPED OR REMOVED
- (1) EQUIPPED
- (9) UNKNOWN

1
46

OCCUPANT INFORMATION OC-3

OCCUPANT EYEWEAR

- (0) NONE
- (1) GLASSES
- (2) CONTACTS
- (3) BOTH GLASSES AND CONTACTS
- (4) OTHER _____
- (8) NOT APPLICABLE
- (9) UNKNOWN

0
47


SOURCE OF INFORMATION

- 0 INTERVIEW
- (1) HOSPITAL
- (2) AUTOPSY
- (3) POLICE
- (4) OTHER _____
- (5) LAY CORONER/EXTERNAL EXAM
- (7) COMBINATION OF ABOVE (CIRCLE)
- (8) NOT APPLICABLE
- (9) UNKNOWN

7
48

OCCUPANT INFORMATION OC-4

INDICATE LOCATION OF INJURIES.

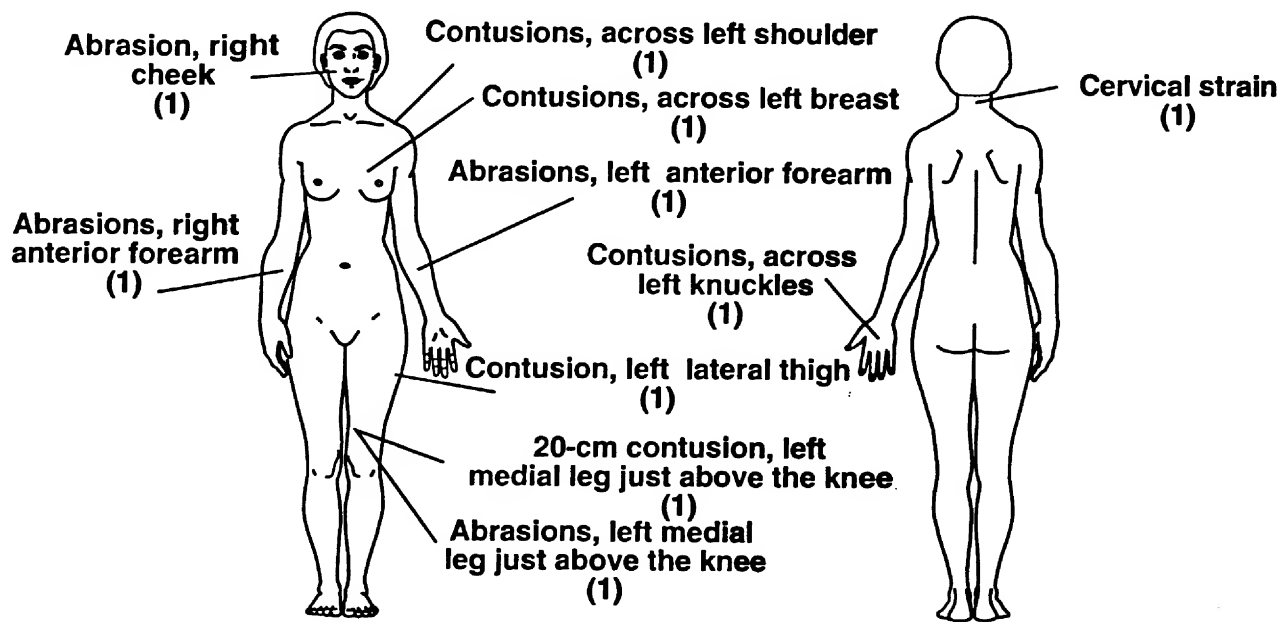

Duplicate columns 1-8
from the previous card.

Module 1 C Format 0 1
9 10 11 12

INJURY CLASSIFICATION IC-1

NOTE: Each line in the table below is a separate record (card).
Duplicate columns 1 - 12 for each completed line.

OCCUPANT INJURY CLASSIFICATION

					PRIMARY OIC					ASSOCIATED OIC					COMMENTS
OCCUPANT NUMBER	INJURY NUMBER	PLACE CONTACTS IN ORDER OF PROBABILITY (HORIZONTALLY). START WITH MOST PROBABLE IN 1ST CONTACT AREA COLUMN.		AREA(S) OF POSSIBLE CONTACT 1ST 2ND	BODY REGION 1	ASPECT 2	LESION 3	SYSTEM/ORGAN 4	SEVERITY 5	BODY REGION 1	ASPECT 2	LESION 3	SYSTEM/ORGAN 4	SEVERITY 5	
		17-18	19-20												
13-14	15-16	17-18	19-20	COMMENTS	21	22	23	24	25	26	27	28	29	30	
01	01	98	--	FLING INTO IP or object	N	P	I	M	I	--	--	--	--	--	
	02	87	--		F	R	A	I	I	--	--	--	--	--	
	03	34	--		S	L	C	I	I	--	--	--	--	--	
	04	34	--		C	L	C	I	I	--	--	--	--	--	
	05	87	--		R	L	A	I	I	--	--	--	--	--	
	06	87	--		R	R	A	I	I	--	--	--	--	--	
	07	05	87		W	L	C	I	I	--	--	--	--	--	
	08	48	--		I	L	C	I	I	--	--	--	--	--	
	09	48	--		I	L	A	I	I	--	--	--	--	--	
	10	20	--		I	L	C	I	I	--	--	--	--	--	
	--	--	--		--	--	--	--	--	--	--	--	--	--	
	--	--	--		--	--	--	--	--	--	--	--	--	--	
	--	--	--		--	--	--	--	--	--	--	--	--	--	
	--	--	--		--	--	--	--	--	--	--	--	--	--	
	--	--	--		--	--	--	--	--	--	--	--	--	--	
	--	--	--		--	--	--	--	--	--	--	--	--	--	
	--	--	--		--	--	--	--	--	--	--	--	--	--	
	--	--	--		--	--	--	--	--	--	--	--	--	--	
	--	--	--		--	--	--	--	--	--	--	--	--	--	

NOTE: USE ADDITIONAL PAGES IF NECESSARY.

INJURY CLASSIFICATION IC-2

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

FRONT OF PASSENGER COMPARTMENT

- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (12) WINDSHIELD
- (05) INSTRUMENT PANEL (*SPECIFIC AREA UNKNOWN*)
- (54) UPPER INSTRUMENT PANEL (X)
- (55) MIDDLE INSTRUMENT PANEL (Y)
- (56) LOWER INSTRUMENT PANEL (Z)
- (81) ASH TRAY (*INSTRUMENT PANEL*)
- (02) GLOVE COMPARTMENT AREA
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (57) BENEATH INSTRUMENT PANEL
- (53) PARCEL TRAY
- (48) KNEE RESTRAINT
- (86) VERTICAL CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (09) STEERING ASSEMBLY (*SPECIFIC AREA UNKNOWN*)
- (65) STEERING WHEEL
- (66) STEERING WHEEL COLUMN
- (59) TRANSMISSION LEVER ON COLUMN
- (03) HARDWARE ITEM (*SPECIFIC AREA UNKNOWN*)
- (82) INSTRUMENT(S)
- (83) CONTROL KNOB(S) & LEVER(S) (*FRONT*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (67) IGNITION KEY
- (06) MIRROR
- (04) HEATER OR AIR CONDITIONING DUCTS
- (01) AIR CONDITIONING OR VENTILATION OUTLET(S)
- (08) RADIO (*BUILT IN*)
- (58) ADD-ON TAPE DECK, RADIO, A/C
- (68) ROOF MOUNTED CONTROLS/CONSOLES

REAR

- (88) SURFACE OF REAR INTERIOR
- (23) REAR WINDOW
- (39) REAR WINDOW HEADER
- (50) REAR SEAT CUSHION & BACK

INTERIOR-GENERAL

- (11) TRANSMISSION SELECTION LEVER (*LOCATION UNK.*)
- (59) TRANSMISSION LEVER ON STEERING COLUMN
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (07) PARKING BRAKE HANDLE (*LOCATION UNKNOWN*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (29) FRONT SEAT-BACK(S)
- (51) FRONT SEAT CUSHION
- (50) REAR SEAT CUSHION & BACK
- (49) ARMREST ON SEAT
- (89) UNDER SEAT BOTTOM
- (33) RESTRAINT SYSTEM HARDWARE
- (34) RESTRAINT SYSTEM WEBBING
- (87) AIR CUSHION SKIN (*AIRBAG*)
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (46) AIRBAG GAS
- (48) KNEE RESTRAINT
- (30) HEAD RESTRAINT
- (42) CHILD SEAT RESTRAINTS
- (43) CHILD SEAT
- (31) INTERIOR LOOSE OBJECT
- (32) OTHER OCCUPANT(S)
- (52) INTERNAL FLYING GLASS (*FROM ANY SOURCE*)
- (41) UNKNOWN INTERIOR SURFACE

SIDES

- (20) SURFACE OF SIDE INTERIOR
- (19) HARDWARE ON SIDE OR DOOR
- (13) ARMREST ON SIDE OR DOOR
- (24) COAT HOOK

- (22) WINDOW GLASS (*SIDE*)
- (21) WINDOW FRAMES (*SIDE*)

- (26) ROOF SIDE RAIL
- (14) A-PILLAR
- (15) B-PILLAR
- (16) C-PILLAR
- (17) D-PILLAR

FLOOR

- (40) FLOOR
- (27) CONSOLE ON FLOOR OR BETWEEN SEATS
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (91) KICKPANEL

ROOF

- (25) ROOF OR CONVERTIBLE TOP
- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (26) ROOF SIDE RAIL
- (24) COAT HOOK
- (18) DOME LIGHT
- (39) BACKLIGHT HEADER
- (68) ROOF MOUNTED CONTROLS/CONSOLE
- (69) ROLL BAR

EXTERIOR SURFACE OF CASE VEHICLE

- (37) OUTSIDE SURFACE OF CASE VEHICLE (*SPECIFIC AREA UNKNOWN*)
- (35) HOOD OF CASE VEHICLE
- (60) EXTERIOR OF CASE VEHICLE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (62) EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE
- (63) TRUNK LID OF CASE VEHICLE
- (64) TIRES OF CASE VEHICLE

BEYOND CASE VEHICLE BOUNDARY

- (36) AREA EXTERIOR TO CAR (*SPECIFIC AREA UNK.*)
- (70) HOOD OF OTHER VEHICLE
- (71) OTHER VEHICLE EXTERIOR HARDWARE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (73) EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE
- (74) HEADLIGHT OR FRONT GRILL OF OTHER VEH.
- (75) TRUNK OF OTHER VEHICLE
- (76) OUTSIDE SURFACE OF OTHER VEHICLE
- (77) TIRES OF OTHER VEHICLE
- (78) GROUND
- (79) WATER
- (80) EXTERIOR OBJECT (*NOT VEHICLE, GROUND, OR WATER. PLEASE DESCRIBE.*)

PENETRATING OBJECTS


- (61) OTHER VEHICLE
- (72) OBJECTS (*DESCRIBE*)

MISCELLANEOUS

- (00) NO CONTACT (*INVALID FIELD FORM CODE*)
- (38) OTHER (*E.G. FIRE. DESCRIBE*)
- (90) SPARE TIRE
- (96) INDUCED
- (97) EJECTED, UNKNOWN CONTACT
- (98) IMPACT FORCE, "WHIPLASH", HYPEREXTENSION/COMPRESSION
- (99) UNKNOWN AREA OF CONTACT

INJURY CLASSIFICATION IC-3

THE FIGURE BELOW
IS AN EXPLANATION OF THE BODY REGION CODES
LISTED ON PAGE IC - 4.

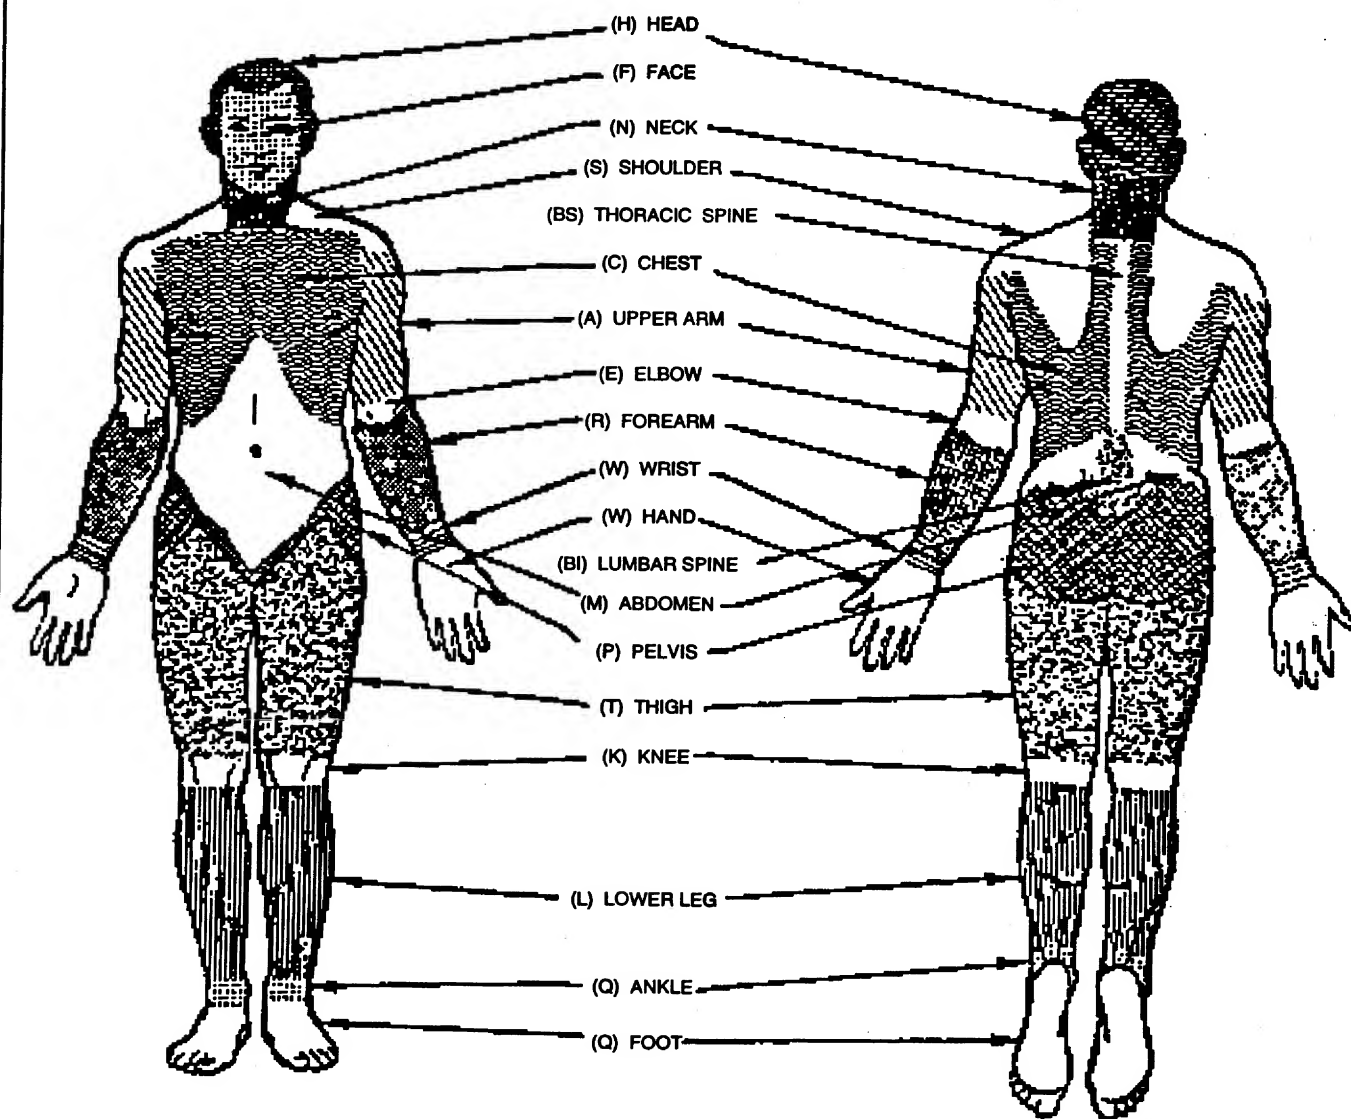

INJURY CLASSIFICATION IC-4

CODES FOR OCCUPANT INJURY CLASSIFICATION (OIC)

1 BODY REGION

(H) HEAD/SKULL
 (F) FACE
 (N) NECK
 (S) SHOULDER
 (X) UPPER EXTREMITIES
 (A) ARM (*UPPER*)
 (E) ELBOW
 (R) FOREARM
 (W) WRIST/HAND
 (C) CHEST
 (M) ABDOMEN
 (B) BACK
 (P) PELVIC/HIP
 (Y) LOWER EXTREMITIES
 (T) THIGH
 (K) KNEE
 (L) LEG (*LOWER*)
 (Q) ANKLE/FOOT
 (O) WHOLE BODY
 (U) UNKNOWN

3 LESION

(L) LACERATION
 (C) CONTUSION
 (A) ABRASION
 (F) FRACTURE
 (P) PERFORATION,
 PUNCTURE
 (K) CONCUSSION
 (V) AVULSION
 (R) RUPTURE
 (S) SPRAIN
 (D) DISLOCATION
 (N) CRUSH
 (M) AMPUTATION
 (B) BURN
 (G) DETACHMENT,
 SEPARATION
 (Z) FRACTURE AND
 DISLOCATION
 (T) STRAIN
 (E) TOTAL SEVERANCE,
 TRANSECTION
 (O) OTHER
 (U) UNKNOWN

4 SYSTEM/ORGAN

(S) SKELETAL
 (V) VERTEBRAE
 (J) JOINTS
 (D) DIGESTIVE
 (L) LIVER
 (N) NERVOUS SYSTEM
 (B) BRAIN
 (C) SPINAL CORD
 (E) EARS
 (O) EYES
 (A) ARTERIES
 (H) HEART
 (Q) SPLEEN
 (G) UROGENITAL
 (K) KIDNEYS
 (R) RESPIRATORY
 (P) PULMONARY/LUNGS
 (M) MUSCLES
 (T) THYROID, OTHER
 ENDOCRINE GLAND
 (I) INTEGUMENTARY (*SKIN*)
 (W) ALL SYSTEMS IN REGION
 (U) UNKNOWN

2 ASPECT

(R) RIGHT
 (L) LEFT
 (B) BILATERAL
 (C) CENTRAL
 (A) ANTERIOR/FRONT
 (P) POSTERIOR/BACK
 (S) SUPERIOR/UPPER
 (I) INFERIOR/LOWER
 (W) WHOLE REGION
 (U) UNKNOWN

BODY REGION	ASPECT	LESION	SYSTEM/ORGAN	SEVERITY
1	2	3	4	5

5 SEVERITY
(OR "AIS", ABBREVIATED INJURY SCALE)

(0) NONE
 (1) MINOR
 (2) MODERATE
 (3) SERIOUS
 (4) SEVERE
 (5) CRITICAL
 (6) MAXIMUM
 (9) UNKNOWN

Duplicate columns 1-8
from the previous card.Module 0 0 Format 0 2
9 10 11 12

OCCUPANT INFORMATION OC-1

OCCUPANT IDENTIFICATION

OCCUPANT NUMBER

02
13 14

ROLE OF OCCUPANT AT 1ST IMPACT

- (1) MOTOR VEHICLE DRIVER
 (2) MOTOR VEHICLE PASSENGER
 (NOT DRIVER)
 (9) UNKNOWN

2
15

PHYSICAL DESCRIPTION

AGE IN YEARS

- (00) LESS THAN 1 YEAR
 (98) 98 YEARS OR OLDER
 (99) UNKNOWN

51
20 21

AGE IN MONTHS

- (00) LESS THAN 1 MONTH
 (25) 25 MONTHS OR OLDER
 (99) UNKNOWN

25
22 23

MASS (kg)

(999) UNKNOWN

190086
24 25 26

HEIGHT (cm)

(999) UNKNOWN

5'6168
27 28 29

SEX

- (1) MALE
 (2) FEMALE
 (9) UNKNOWN

2
30

OCCUPANT POSITION

ROW LOCATION

- (1) FRONT
 (2) SECOND
 (3) THIRD
 (4) FOURTH
 (7) OTHER: _____
 (8) EXTERNAL TO PASSENGER
 COMPARTMENT (E.G. BED OF PICKUP)
 (9) UNKNOWN

1
16

LATERAL LOCATION

- (1) LEFT
 (2) LEFT CENTER
 (3) CENTER
 (4) RIGHT CENTER
 (5) RIGHT
 (6) ALL (LYING ON SEAT)
 (8) EXTERNAL TO PASSENGER
 COMPARTMENT
 (9) UNKNOWN

5
17

POSTURE

- (10) SITTING ON SEAT
 (11) SITTING ON SEAT IN ABNORMAL
 POSITION (E.G. FEET ON DASH,
 SIDEWAYS)
 (12) SITTING ON CONSOLE
 (20) ON LAP OR IN ARMS
 (30) STANDING ON SEAT
 (40) STANDING ON FLOOR
 (47) STANDING, EXTERNAL TO
 PASSENGER COMPARTMENT
 (50) IN BASSINET
 (60) IN CHILD SEAT
 (65) IN CHILD HARNESS
 (70) LYING ON SEAT
 (80) LYING/SITTING ON PASSENGER
 FLOOR
 (83) LYING/SITTING ON OTHER
 OBJECT IN PASSENGER
 COMPARTMENT: _____
 (85) ON CARGO FLOOR/FOLDED
 SEAT-BACK
 (87) LYING/SITTING, EXTERNAL TO
 PASSENGER COMPARTMENT
 (97) OTHER: _____
 (99) UNKNOWN

10
18 19

MEDICAL CONDITIONS

TREATMENT/MORTALITY

- (00) NONE
 (01) FIRST AID AT SCENE
 (02) TREATED AT HOSPITAL/CLINIC
 BUT NOT ADMITTED
 (03) HOSPITALIZED FOR OBSERVATION
 LESS THAN 24 HOURS
 (04) HOSPITALIZED OVER 24 HOURS
 OR FOR SIGNIFICANT TREATMENT
 (05) FATAL, DEAD AT SCENE
 (06) FATAL, DOA
 (07) FATAL, DEAD WITHIN 24 HOURS
 (08) FATAL, DEAD 24 HOURS TO
 31 DAYS LATER
 (09) FATAL, DEAD 31 DAYS TO
 1 YEAR LATER
 (10) FATAL DEAD WITHIN UNKNOWN
 PERIOD
 (99) UNKNOWN

02
31 32

INJURY SEVERITY SCORE (ISS)

(99) UNKNOWN

01
33 34

NON-IMPACT MED. CONDITIONS

- (0) NONE
 (1) YES, TIME & TYPE UNKNOWN
 (2) PRE-CRASH FATAL (CLINICAL
 DEATH AT WHEEL)
 (3) PRE-CRASH NON-FATAL (E.G.
 PRIOR INJURY, STROKE)
 (4) PREGNANT
 (5) POST-CRASH FATAL (DROWNING)
 (6) POST-CRASH NON-FATAL INJURY
 (7) OTHER: _____
 (8) COMBINATION OF ABOVE
 (CIRCLE EACH)
 (9) UNKNOWN

0
35

OCCUPANT INFORMATION OC-2					
MEDICAL CONDITIONS (CONT.) POLICE INJURY SEVERITY CODE FOR THIS OCCUPANT (0) O - NO INJURY (1) C - POSSIBLE INJURY (2) B - NON-INCAPACITATING (3) A - INCAPACITATING INJURY (4) K - FATAL (5) INJURED, SEVERITY UNKNOWN (6) DIED PRIOR TO IMPACT (7) NON-FATAL INJURY, SEVERITY UNKNOWN (9) UNKNOWN		<u>3</u> 36	CHILD SEAT TYPE (00) NONE USED (01) YES, USED (02) INTEGRAL, Chrysler Mini-van (88) NOT APPLICABLE (ADULT OR OLDER CHILD) (99) UNKNOWN CHILD SEAT MAKE/MODEL <hr/> <hr/> <hr/>		<div>88</div> <div>41 42</div>
RESTRAINT SYSTEM ACTIVE RESTRAINT SYSTEM (0) NONE (1) LAP BELT (2) SHOULDER HARNESS ONLY (3) BOTH LAP BELT & SHOULDER HARNESS (9) UNKNOWN ACTIVE RESTRAINT SYSTEM USAGE (0) NONE (AVAILABLE BUT NOT USED) (1) LAP BELT ONLY (2) SHOULDER HARNESS ONLY (3) BOTH LAP BELT & SHOULDER HARNESS (7) IMPROPER USAGE (8) NOT APPLICABLE (NONE AVAILABLE) (9) UNKNOWN PASSIVE RESTRAINT SYSTEM (0) NONE (1) AIRBAG INSTALLED (2) PASSIVE UPPER TORSO WITH KNEE BOLSTERS (3) PASSIVE UPPER TORSO WITHOUT KNEE BOLSTERS (4) PASSIVE LAP & UPPER TORSO (5) AIRBAG INSTALLED & PASSIVE RESTRAINT (7) OTHER: _____ (9) UNKNOWN PASSIVE RESTRAINT SYSTEM USAGE (0) SYSTEM DEFEATED (1) AIRBAG NOT DEPLOYED (2) AIRBAG DEPLOYED (3) AIRBAG NOT REINSTALLED (4) PASSIVE UPPER TORSO USED (5) PASSIVE LAP & UPPER TORSO USED (6) SYSTEM USED IN MANUAL MODE (7) IMPROPER USAGE (8) NOT APPLICABLE (NOT ORIGINALLY EQUIPPED) (9) UNKNOWN		<div>3</div> <div>37</div> <div>3</div> <div>38</div> <div>1</div> <div>39</div> <div>2</div> <div>40</div>	EJECTION DEGREE OF EJECTION (0) NONE (1) PARTIAL (2) COMPLETE (7) EJECTED, DEGREE UNKNOWN (9) UNKNOWN IF EJECTED AREA OF EJECTION (01) WINDOW, LEFT SIDE (02) WINDOW, RIGHT SIDE (03) WINDOW, REAR (04) DOOR, LEFT SIDE (05) DOOR, RIGHT SIDE (06) DOOR, REAR OR TAILGATE (07) WINDSHIELD (08) ROOF OR OPEN CONVERTIBLE OR FROM EXTERNAL AREA (96) EJECTED AREA UNKNOWN (97) OTHER AREA: _____ (98) NOT APPLICABLE (NOT EJECTED) (99) UNKNOWN IF EJECTED		<div>O</div> <div>43</div> <div>98</div> <div>44 45</div>
IF OCCUPANT WAS EJECTED, DESCRIBE IN DETAIL BELOW: <hr/> <hr/> <hr/> <hr/>					
			HEAD RESTRAINT HEAD RESTRAINT AVAILABLE FOR THIS POSITION (0) NOT EQUIPPED OR REMOVED (1) EQUIPPED (9) UNKNOWN		<div>1</div> <div>46</div>

OCCUPANT INFORMATION OC-3

OCCUPANT EYEWEAR

- (0) NONE
- (1) GLASSES
- (2) CONTACTS
- (3) BOTH GLASSES AND CONTACTS
- (4) OTHER _____
- (8) NOT APPLICABLE
- (9) UNKNOWN

FLW OFF
NOT BROKEN

1
47


SOURCE OF INFORMATION

- (0) INTERVIEW
- (1) HOSPITAL
- (2) AUTOPSY
- (3) POLICE
- (4) OTHER _____
- (5) LAY CORONER/EXTERNAL EXAM
- (7) COMBINATION OF ABOVE (CIRCLE)
- (8) NOT APPLICABLE
- (9) UNKNOWN

7
48

OCCUPANT INFORMATION OC-4

INDICATE LOCATION OF INJURIES.

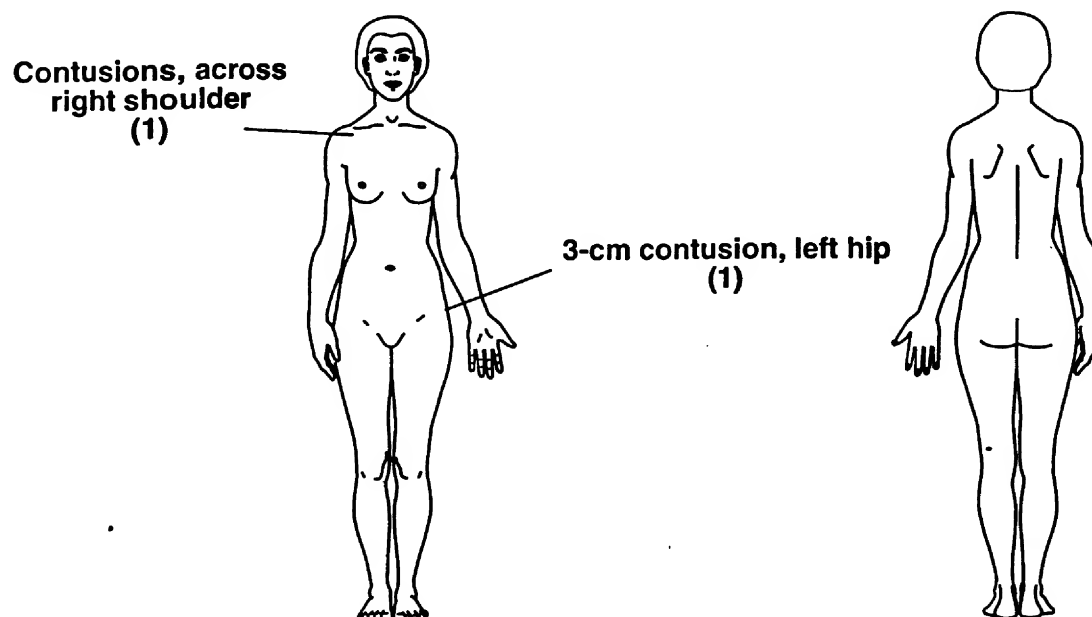

Duplicate columns 1-8
from the previous card.

Module 1 C Format 0 1
9 10 11 12

INJURY CLASSIFICATION IC-1

NOTE: Each line in the table below is a separate record (card).
Duplicate columns 1 - 12 for each completed line.

OCCUPANT INJURY CLASSIFICATION

					PRIMARY OIC					ASSOCIATED OIC					COMMENTS	
OCCUPANT NUMBER	INJURY NUMBER	PLACE CONTACTS IN ORDER OF PROBABILITY (HORIZONTALLY). START WITH MOST PROBABLE IN 1ST CONTACT AREA COLUMN.		AREA(S) OF POSSIBLE CONTACT 1ST 2ND	BODY REGION 1	ASPECT 2	LESION 3	SYSTEM/ORGAN 4	SEVERITY 5	BODY REGION 1	ASPECT 2	LESION 3	SYSTEM/ORGAN 4	SEVERITY 5		
13-14	15-16	17-18	19-20	COMMENTS	21	22	23	24	25	26	27	28	29	30		
<u>02</u>	<u>01</u>	<u>34</u>	--		S	R	C	I	I	--	--	--	--	--		
<u>02</u>	<u>33</u>	--	P		L	C	I	I	--	--	--	--	--			
--	--	--	--		--	--	--	--	--	--	--	--	--	--		--
--	--	--	--		--	--	--	--	--	--	--	--	--	--		--
--	--	--	--		--	--	--	--	--	--	--	--	--	--		--
--	--	--	--		--	--	--	--	--	--	--	--	--	--		--
--	--	--	--		--	--	--	--	--	--	--	--	--	--		--
--	--	--	--		--	--	--	--	--	--	--	--	--	--		--
--	--	--	--		--	--	--	--	--	--	--	--	--	--		--
--	--	--	--		--	--	--	--	--	--	--	--	--	--		--
--	--	--	--		--	--	--	--	--	--	--	--	--	--		--
--	--	--	--		--	--	--	--	--	--	--	--	--	--		--
--	--	--	--		--	--	--	--	--	--	--	--	--	--		--
--	--	--	--		--	--	--	--	--	--	--	--	--	--		--
--	--	--	--		--	--	--	--	--	--	--	--	--	--		--
--	--	--	--		--	--	--	--	--	--	--	--	--	--		--
--	--	--	--		--	--	--	--	--	--	--	--	--	--		--
--	--	--	--		--	--	--	--	--	--	--	--	--	--		--
--	--	--	--		--	--	--	--	--	--	--	--	--	--		--

NOTE: USE ADDITIONAL PAGES IF NECESSARY.

INJURY CLASSIFICATION IC-2

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

FRONT OF PASSENGER COMPARTMENT

- (10) SUNVISOR, FITTING(S) & OR TOP MOLDING
- (12) WINDSHIELD
- (05) INSTRUMENT PANEL (*SPECIFIC AREA UNKNOWN*)
- (54) UPPER INSTRUMENT PANEL (X)
- (55) MIDDLE INSTRUMENT PANEL (Y)
- (56) LOWER INSTRUMENT PANEL (Z)
- (81) ASH TRAY (*INSTRUMENT PANEL*)
- (02) GLOVE COMPARTMENT AREA
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (57) BENEATH INSTRUMENT PANEL
- (53) PARCEL TRAY
- (48) KNEE RESTRAINT
- (86) VERTICAL CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (09) STEERING ASSEMBLY (*SPECIFIC AREA UNKNOWN*)
- (65) STEERING WHEEL
- (66) STEERING WHEEL COLUMN
- (59) TRANSMISSION LEVER ON COLUMN
- (03) HARDWARE ITEM (*SPECIFIC AREA UNKNOWN*)
- (82) INSTRUMENT(S)
- (83) CONTROL KNOB(S) & LEVER(S) (*FRONT*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (67) IGNITION KEY
- (06) MIRROR
- (04) HEATER OR AIR CONDITIONING DUCTS
- (01) AIR CONDITIONING OR VENTILATION OUTLET(S)
- (08) RADIO (*BUILT IN*)
- (58) ADD-ON TAPE DECK, RADIO, A/C
- (68) ROOF MOUNTED CONTROLS/CONSOLES

REAR

- (88) SURFACE OF REAR INTERIOR
- (23) REAR WINDOW
- (39) REAR WINDOW HEADER
- (50) REAR SEAT CUSHION & BACK

INTERIOR-GENERAL

- (11) TRANSMISSION SELECTION LEVER (*LOCATION UNK.*)
- (59) — TRANSMISSION LEVER ON STEERING COLUMN
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (07) PARKING BRAKE HANDLE (*LOCATION UNKNOWN*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (29) FRONT SEAT-BACK(S)
- (51) FRONT SEAT CUSHION
- (50) REAR SEAT CUSHION & BACK
- (49) ARMREST ON SEAT
- (89) UNDER SEAT BOTTOM
- (33) RESTRAINT SYSTEM HARDWARE
- (34) RESTRAINT SYSTEM WEBBING
- (87) AIR CUSHION SKIN (*AIRBAG*)
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (46) AIRBAG GAS
- (48) KNEE RESTRAINT
- (30) HEAD RESTRAINT
- (42) CHILD SEAT RESTRAINTS
- (43) CHILD SEAT
- (31) INTERIOR LOOSE OBJECT
- (32) OTHER OCCUPANT(S)
- (52) INTERNAL FLYING GLASS (*FROM ANY SOURCE*)
- (41) UNKNOWN INTERIOR SURFACE

SIDES

- (20) SURFACE OF SIDE INTERIOR
- (19) HARDWARE ON SIDE OR DOOR
- (13) ARMREST ON SIDE OR DOOR
- (24) COAT HOOK
- (22) WINDOW GLASS (*SIDE*)
- (21) WINDOW FRAMES (*SIDE*)
- (26) ROOF SIDE RAIL
- (14) A-PILLAR
- (15) B-PILLAR
- (16) C-PILLAR
- (17) D-PILLAR

FLOOR

- (40) FLOOR
- (27) CONSOLE ON FLOOR OR BETWEEN SEATS
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (91) KICKPANEL

ROOF

- (25) ROOF OR CONVERTIBLE TOP
- (10) SUNVISOR, FITTING(S) & OR TOP MOLDING
- (26) ROOF SIDE RAIL
- (24) COAT HOOK
- (18) DOME LIGHT
- (39) BACKLIGHT HEADER
- (68) ROOF MOUNTED CONTROLS/CONSOLE
- (69) ROLL BAR

EXTERIOR SURFACE OF CASE VEHICLE

- (37) OUTSIDE SURFACE OF CASE VEHICLE (*SPECIFIC AREA UNKNOWN*)
- (35) HOOD OF CASE VEHICLE
- (60) EXTERIOR OF CASE VEHICLE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (62) EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE
- (63) TRUNK LID OF CASE VEHICLE
- (64) TIRES OF CASE VEHICLE

BEYOND CASE VEHICLE BOUNDARY

- (36) AREA EXTERIOR TO CAR (*SPECIFIC AREA UNK.*)
- (70) HOOD OF OTHER VEHICLE
- (71) OTHER VEHICLE EXTERIOR HARDWARE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (73) EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE
- (74) HEADLIGHT OR FRONT GRILL OF OTHER VEH.
- (75) TRUNK OF OTHER VEHICLE
- (76) OUTSIDE SURFACE OF OTHER VEHICLE
- (77) TIRES OF OTHER VEHICLE
- (78) GROUND
- (79) WATER
- (80) EXTERIOR OBJECT (*NOT VEHICLE, GROUND, OR WATER. PLEASE DESCRIBE.*)

PENETRATING OBJECTS

- (61) OTHER VEHICLE
- (72) OBJECTS (*DESCRIBE*)

MISCELLANEOUS

- (00) NO CONTACT (*INVALID FIELD FORM CODE*)
- (38) OTHER (*E.G. FIRE. DESCRIBE*)
- (90) SPARE TIRE
- (96) INDUCED
- (97) EJECTED, UNKNOWN CONTACT
- (98) IMPACT FORCE, "WHIPLASH", HYPEREXTENSION/COMPRESSION
- (99) UNKNOWN AREA OF CONTACT

Address: 100000
 Legal Year: 04 1998 Property
 Type: Cemetery L&L 4-unit lot/section
 Status: 42 year old female
 Cemetery: 1988's, section 1 year 0/00 4-unit lot/section
 Case: 01 1988's Ford Mustang 1988 L&L 2-unit lot/section

Location: Clear
 Pl. and location: City
 St. and location: Asphalt
 L. and location: Asphalt

100000



100000

100000

100000

100000

100000

100000

100000

100000

100000

PN 19400 #1



PN 19400 #2



PN 18400 #3
Best Available




PN 19400 #4



PN 19400 #5
Best Available



PN19400#8
Best Available

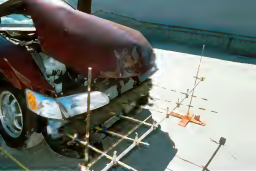

PN 19400 #7

Not Available



PN 19400#8



PN 19400 #9
Best Available



PN 19400#10



PN 18400 #11



PN 19400#12



PN 19400 #13



PN 19400 #14



PN 19400#15



PN 19400 #16



PN 19400#17



PN 19400#18



PN 19400 #19



PN 19400 #20



PN 19400 #21



PN 19400 #22



PN 19400#23



PN 19400 #24




PN 19400 #25



PN 19400 #26



PN 19400 #27

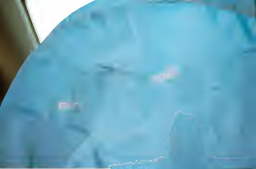

PN 19400 #28



PN 19400#29



PN 19400 #30



PN 19400 #31



PN 19400 #32



PN 19400 #33



PN 19400 #34



PN 19400 #35



PN 19400 #38



PN 19400 #37



PN 19400 #38



PN 19400 #38



PN 19400 #40



PN 19400 #41



PN 19400 #42



PN 18400#43



PN 19400-#44



PN 19400 #45



PN 19400 #46



PN 19400 #47

19400 #49
19400 #49
19400 #49

19400 #49
19400 #49
19400 #49
19400 #49

19400 #49
19400 #49
19400 #49

